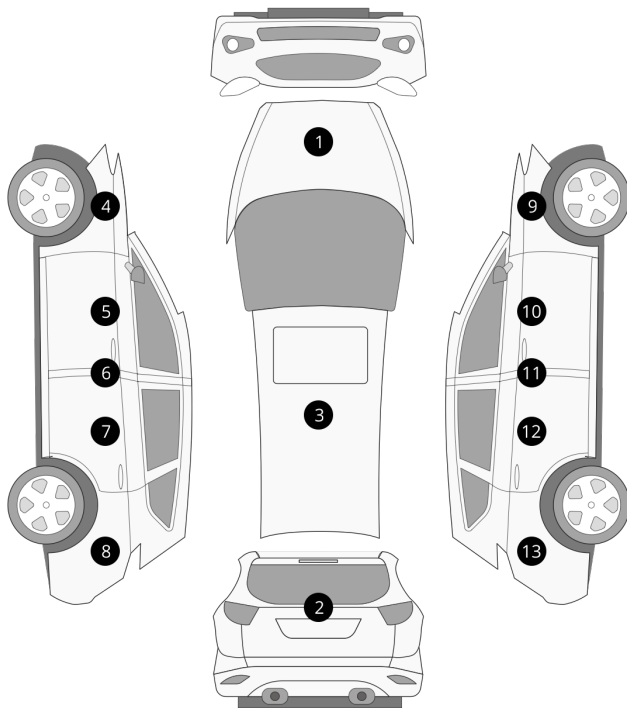


General Information

Date & Time: 22, Jul, 2025 13:53

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	50,539
Registration No.	NEE8532	Chassis No.	PA1B18F38P4204641
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



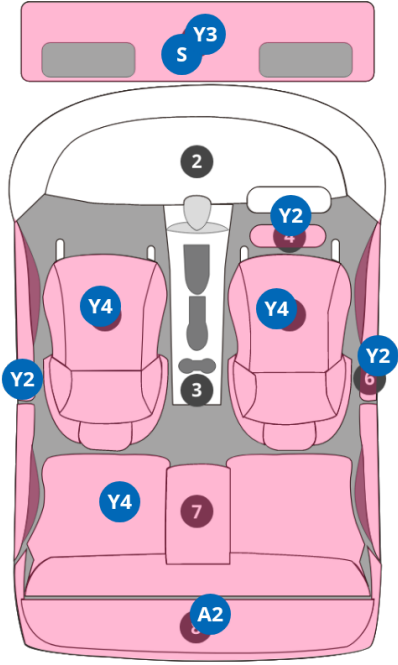
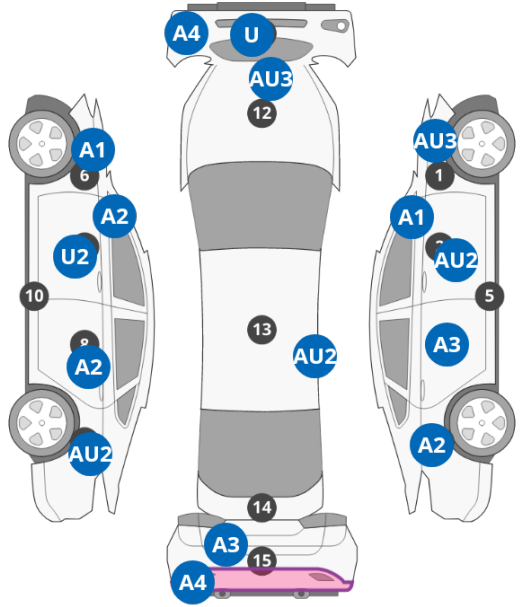
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	111	108	117
2	Boot Lid	110.6	105	108	119
3	Roof	99.7	108	95	91/105
4	Left Front Fender	101.2	101	99	104
5	Left Front Door	103.3	103	103	104
6	Center Panel Left				
7	Left Rear Door	105.4	110	98	108
8	Left Back Panel	114.0	125	108	109
9	Right Front Fender	96.5	100	92	98
10	Right Front Door	101.5	101	98	106
11	Center Panel Right				
12	Right Rear Door	99.4	95	100	103
13	Right Back Panel	102.3	100	100	107

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Overall Interior - Smell - Yes / Rear Seat - Grime - Large / Ceiling - Grime - Medium / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Switches - Partially Missing - Yes / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small	Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Dent - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Medium / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, scratches on headlight and tail light, trunk latch damaged