

General Information

Date & Time: 09, Nov, 2024 15:19

Make	Toyota	Model	Vios
YOM	2024	Mileage	12,058
Registration No.	DBM3767	Chassis No.	PA1B18F39R4242348
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



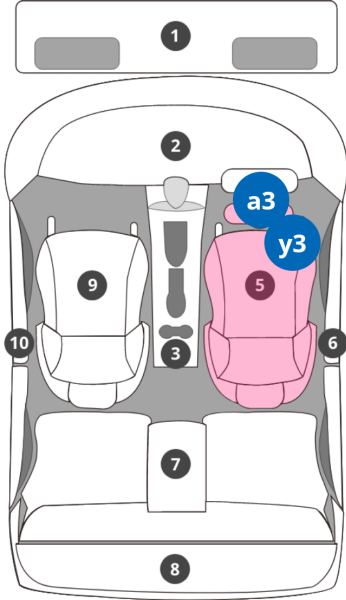
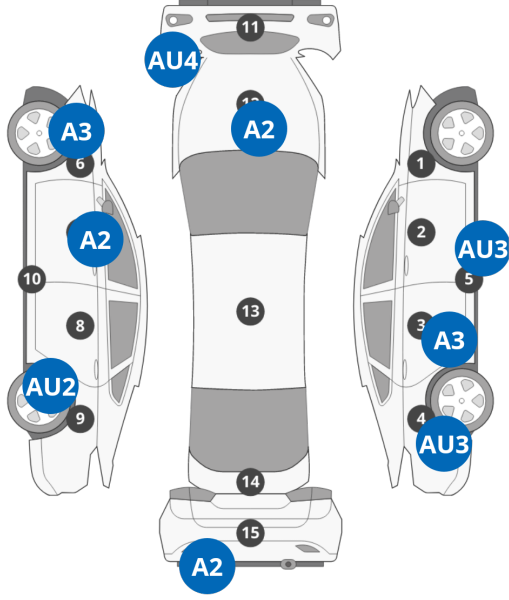
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	148.6	152	139	155
2	Boot Lid	140.0	139	143	138
3	Roof	139.5	145	140	132/141
4	Left Front Fender	126.0	126	125	127
5	Left Front Door	138.3	136	135	144
6	Center Panel Left				
7	Left Rear Door	137.3	144	143	125
8	Left Back Panel	144.6	158	137	139
9	Right Front Fender	141.0	141	140	142
10	Right Front Door	141.0	153	133	137
11	Center Panel Right				
12	Right Rear Door	138.3	137	135	143
13	Right Back Panel	146.0	137	143	158

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Seat - Grime - Medium	Remarks (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

driver side mirror loose/ swirl marks and hairline scratches with spare tire, tools, and jack/ no warranty booklet