

General Information

Date & Time: 18, Jul, 2025 12:55

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	52,849
Registration No.	CBD9080	Chassis No.	MHKA4DF5FNJ070810
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Yellow		

Body / Panel Condition



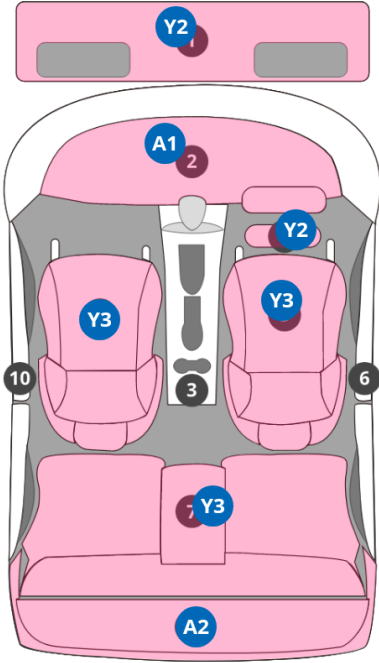
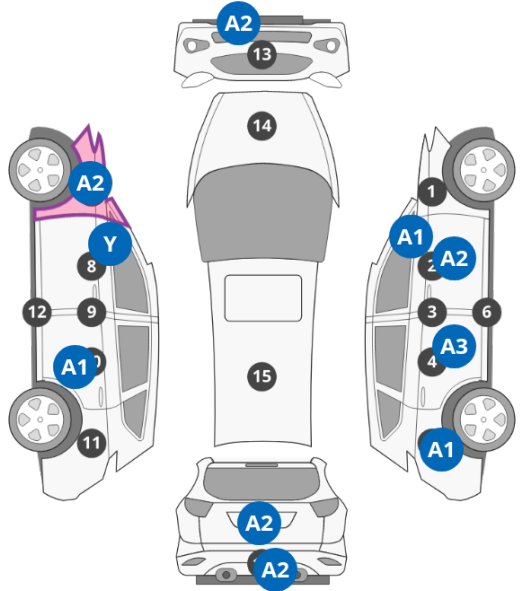
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.3	118	128	130
2	Boot Lid	104.1	98	110	104
3	Roof	85.1	67	87	90/96
4	Left Front Fender	1,014.0	775	1,268	999
5	Left Front Door	130.3	148	131	112
6	Center Panel Left				
7	Left Rear Door	105.3	110	104	102
8	Left Back Panel	95.3	103	96	87
9	Right Front Fender	105.1	112	116	87
10	Right Front Door	103.6	97	104	110
11	Center Panel Right				
12	Right Rear Door	102.2	110	98	98
13	Right Back Panel	104.3	100	103	110

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small / (L) Front Floor Mat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Mirror - Crack - Damaged / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with warranty booklet/with jack and incomplete tools/left side mirror was damage