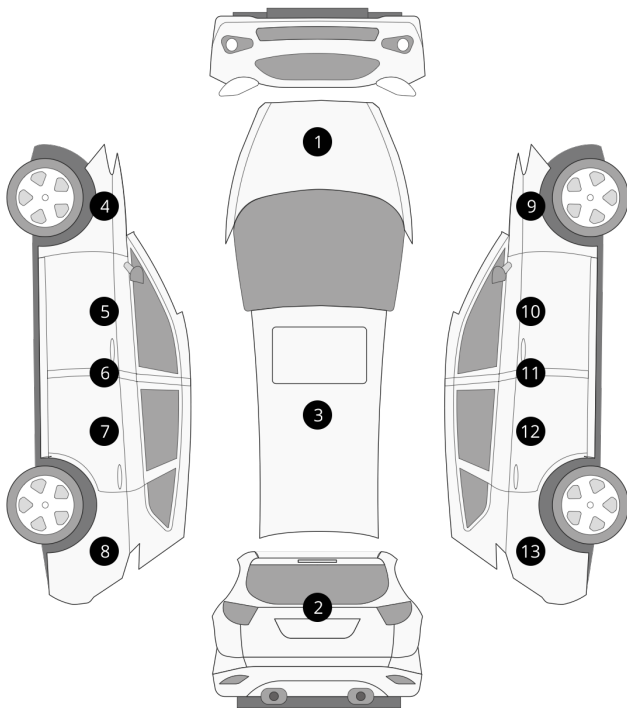


General Information

Date & Time: 21, Jul, 2025 15:48

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	27,632
Registration No.	DAQ2548	Chassis No.	MHKA4DF5FNJ066539
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



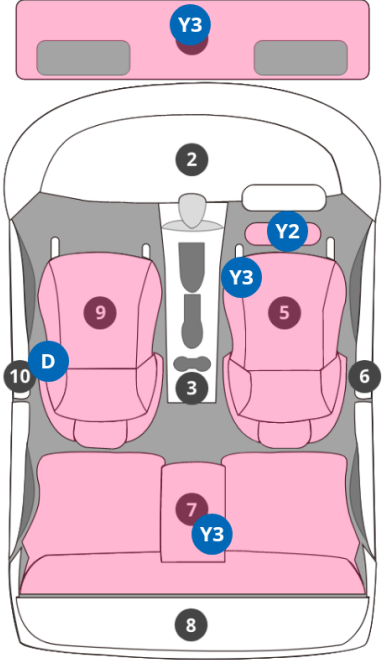
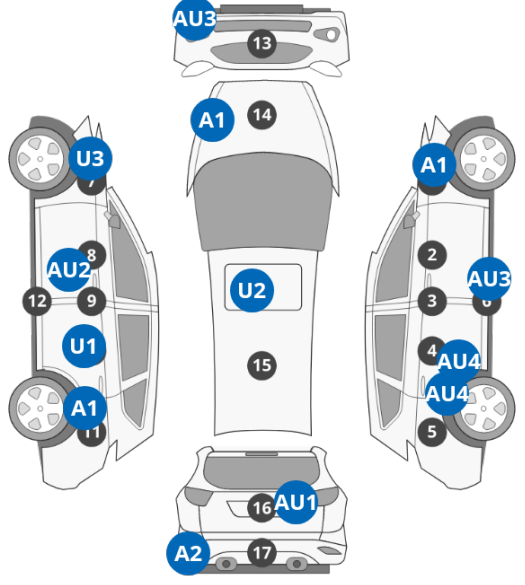
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	68.5	65	72	69
2	Boot Lid	86.2	89	89	80
3	Roof	67.5	63	66	75/66
4	Left Front Fender	69.9	66	80	64
5	Left Front Door	69.4	64	72	72
6	Center Panel Left				
7	Left Rear Door	73.4	74	68	79
8	Left Back Panel	74.3	76	72	75
9	Right Front Fender	69.4	65	73	70
10	Right Front Door	71.5	73	73	69
11	Center Panel Right				
12	Right Rear Door	74.7	75	74	75
13	Right Back Panel	67.6	72	66	65

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on headlight and tail light, horn issue, damaged plate number