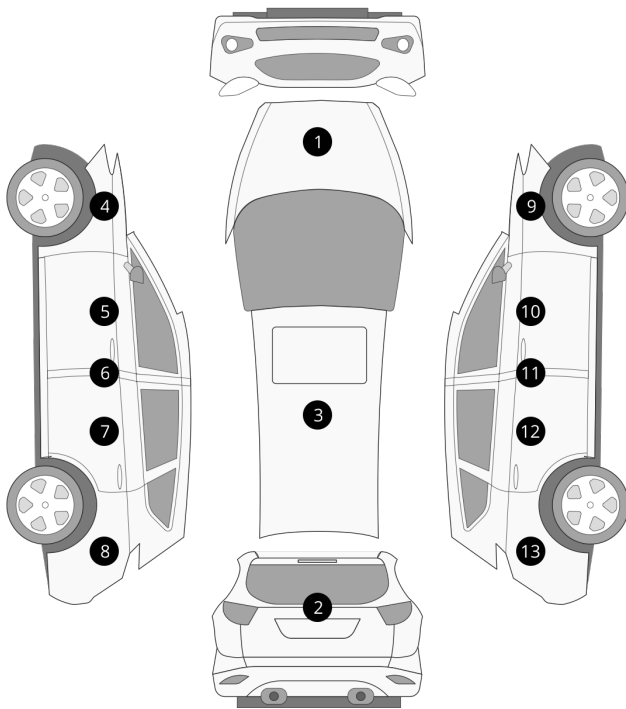


General Information

Date & Time: 21, Jul, 2025 09:05

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	7,645
Registration No.	NEX6224	Chassis No.	MHKA4DF5FMJ061340
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



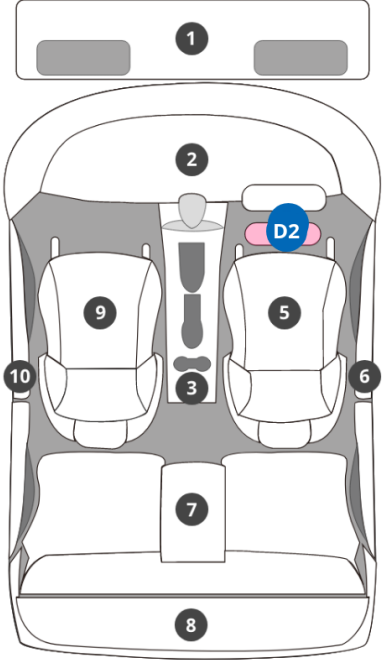
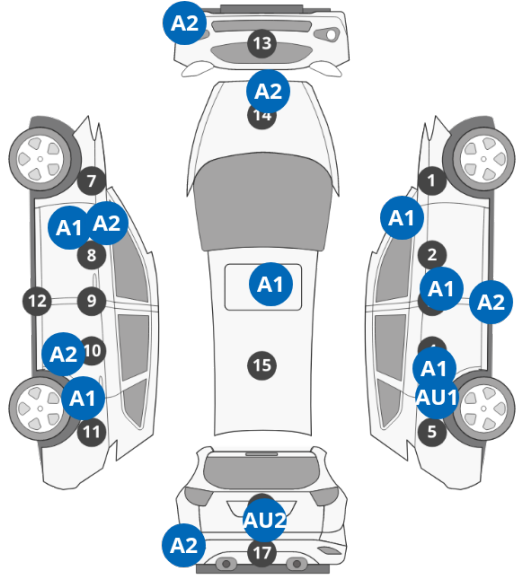
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	72.5	77	77	64
2	Boot Lid	86.8	87	89	85
3	Roof	68.6	59	79	63/74
4	Left Front Fender	75.3	77	75	74
5	Left Front Door	65.3	68	68	60
6	Center Panel Left				
7	Left Rear Door	58.0	58	57	59
8	Left Back Panel	71.7	73	68	75
9	Right Front Fender	73.4	71	71	79
10	Right Front Door	68.2	70	72	63
11	Center Panel Right				
12	Right Rear Door	73.6	75	73	73
13	Right Back Panel	72.0	72	70	75

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small	Remarks (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack, incomplete tools, no spare tire, with LTO plate, scratches on headlight and tail light, window washer hose damage, tonneau cover missing