

General Information

Date & Time: 18, Jul, 2025 14:37

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	52,352
Registration No.	EAE3187	Chassis No.	MHKA4DF5FLJ047887
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



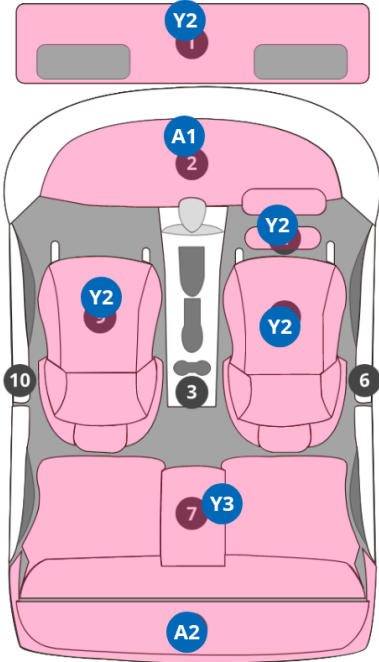
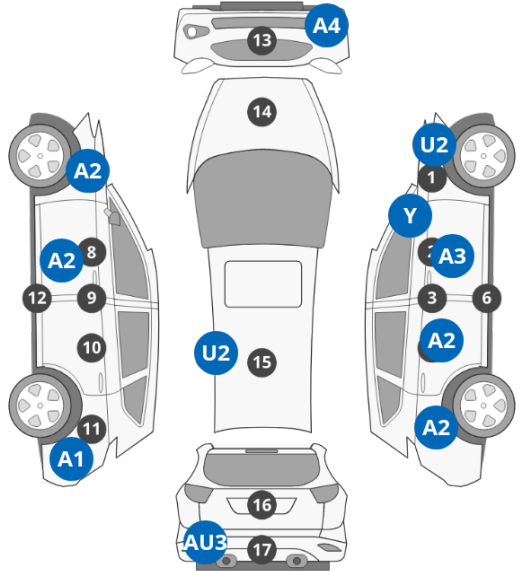
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	88.1	84	97	84
2	Boot Lid	96.4	94	99	97
3	Roof	84.3	75	87	89/86
4	Left Front Fender	91.6	84	96	95
5	Left Front Door	97.3	98	98	97
6	Center Panel Left				
7	Left Rear Door	96.2	96	97	96
8	Left Back Panel	93.0	96	93	90
9	Right Front Fender	96.7	96	101	93
10	Right Front Door	97.6	94	98	101
11	Center Panel Right				
12	Right Rear Door	97.2	100	100	92
13	Right Back Panel	95.8	98	94	95

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Mirror - Crack - Damaged / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Dent - Small / (L) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate/with spare tire/No jack and tools/with warranty booklet/right side mirror issue/right side front bumper small cover missing/trunk spare tire cover issue