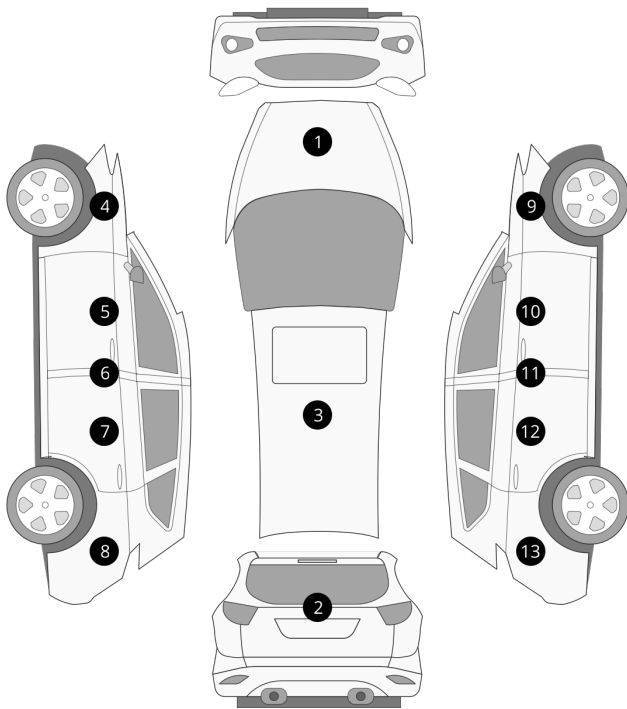


General Information

Date & Time: 18, Jul, 2025 12:27

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	65,882
Registration No.	DBF2638	Chassis No.	PA1B18F37M4155315
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



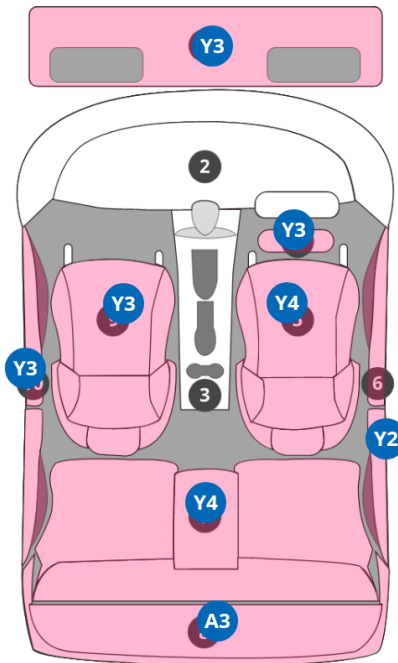
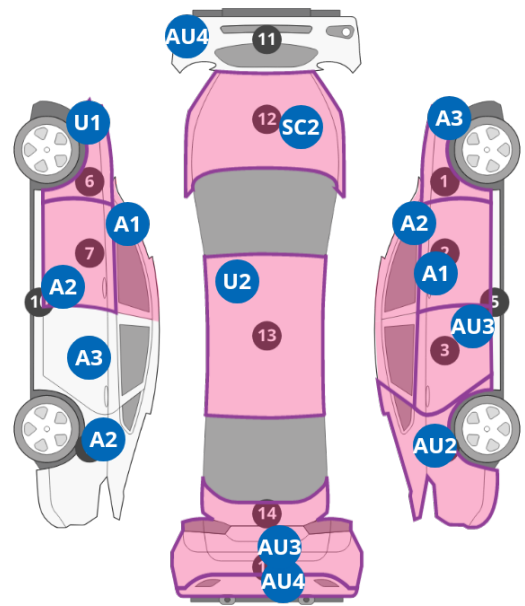
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	114	99	153
2	Boot Lid	176.6	160	231	139
3	Roof	103.7	96	103	87/129
4	Left Front Fender	198.6	237	241	118
5	Left Front Door	98.6	100	104	92
6	Center Panel Left				
7	Left Rear Door	98.9	98	102	97
8	Left Back Panel	105.3	111	101	104
9	Right Front Fender	439.0	920	231	166
10	Right Front Door	94.5	92	91	101
11	Center Panel Right				
12	Right Rear Door	96.5	87	110	93
13	Right Back Panel	179.3	189	198	151

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Medium / Rear Seat - Grime - Large / Mat Other - Grime - Medium / (R) Rear Trim - Grime - Small / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / Ceiling - Grime - Medium / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Roof - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Dent - Small / Bonnet, Headlight - Rust, Corrosion - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, loosed rear seat, scratches on headlight and tail light