


General Information

Date & Time: 21, Jul, 2025 13:37

Make	Toyota	Model	Avanza
YOM	2021	Odo Meter Reading	46,484
Registration No.	NGU8596	Chassis No.	MHKM5EF2FMK028295
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition

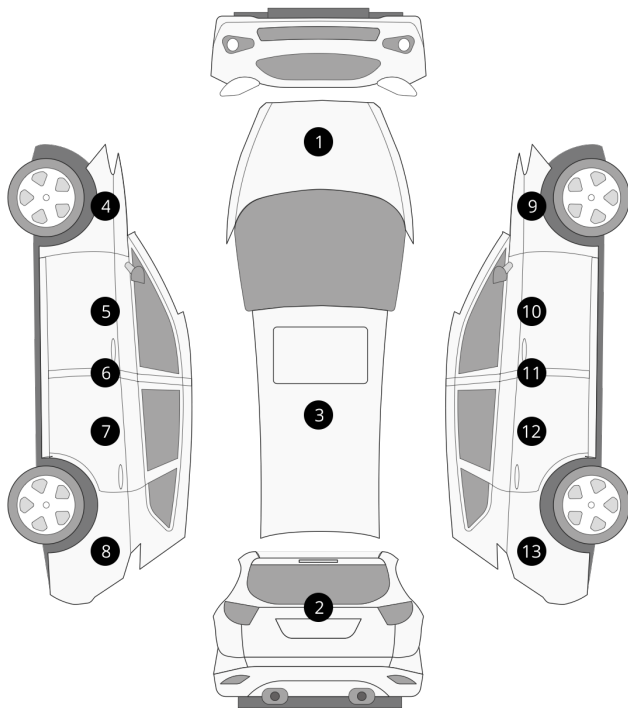


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.6	90	113	90
2	Boot Lid	98.0	94	100	100
3	Roof	91.7	87	83	103/94
4	Left Front Fender	91.6	79	90	106
5	Left Front Door	100.3	108	100	93
6	Center Panel Left				
7	Left Rear Door	98.4	100	101	94
8	Left Back Panel	82.6	78	79	91
9	Right Front Fender	96.1	99	99	91
10	Right Front Door	94.3	87	89	108
11	Center Panel Right				
12	Right Rear Door	92.7	95	94	89
13	Right Back Panel	87.0	86	91	84

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

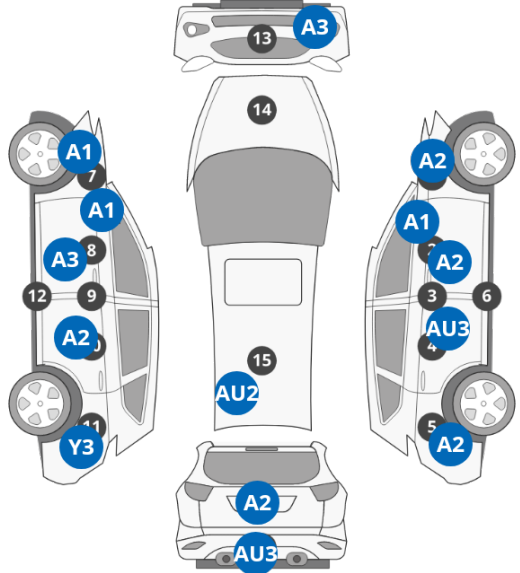Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Trim - Grime - Minimal	Remarks (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack and tools/No warranty booklet/No reverse camera/ No fog light