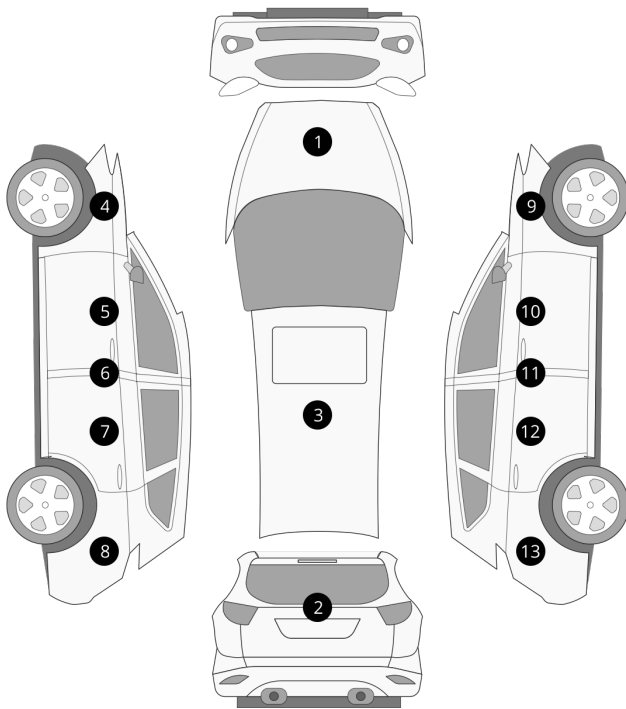


General Information

Date & Time: 21, Jul, 2025 13:56

Make	Toyota	Model	Avanza
YOM	2021	Odo Meter Reading	184,719
Registration No.	DAU9629	Chassis No.	MHKM5FF3FLK006120
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



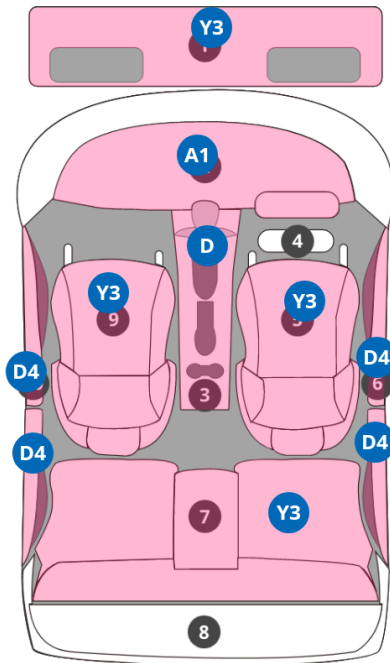
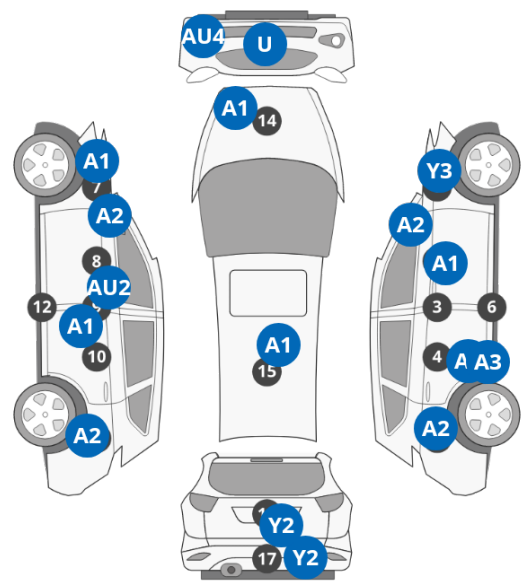
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	249.6	251	249	249
2	Boot Lid	210.0	206	212	212
3	Roof	86.0	79	88	88/89
4	Left Front Fender	224.6	230	227	217
5	Left Front Door	249.3	256	208	284
6	Center Panel Left				
7	Left Rear Door	241.6	261	239	225
8	Left Back Panel	239.6	227	273	219
9	Right Front Fender	186.0	170	159	229
10	Right Front Door	228.0	185	318	181
11	Center Panel Right				
12	Right Rear Door	175.3	176	159	191
13	Right Back Panel	174.0	186	164	172

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Overall Interior - Worn as per age - Yes / (R) Rear Trim - Worked - Large / Ceiling - Grime - Medium / (L) Rear Trim - Worked - Large / (L) Front Trim - Worked - Large / (R) Front Trim - Worked - Large / Console, Switches, Vents - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Small / Trunk Hood, Rear Gate - Crack, Gap - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Member (Bolted) - Dent - Yes
Frame Evaluation : D	Functional Evaluation : D
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with LTO plate, no warranty booklet, with jack and incomplete tools, blown spare tire, trunk door issue, faded headlights, busted tail light , busted foglamps, busted park light, loosed seatbelt buckle, front right ceiling handle missing, overheating issue, temperature lamp on