


General Information

Date & Time: 22, Jul, 2025 10:22

Make	Toyota	Model	Innova
YOM	2021	Odo Meter Reading	64,582
Registration No.	DAT4500	Chassis No.	PA2JA8EM5L0085322
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition

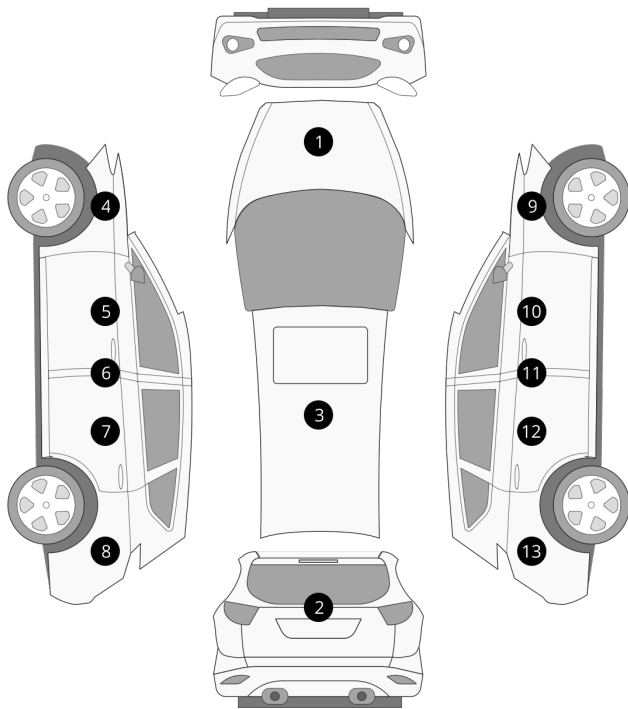

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	107	119	115
2	Boot Lid	99.6	104	106	89
3	Roof	91.0	91	92	97/84
4	Left Front Fender	93.0	93	88	98
5	Left Front Door	93.7	90	95	96
6	Center Panel Left				
7	Left Rear Door	97.8	100	90	104
8	Left Back Panel	98.8	101	100	96
9	Right Front Fender	99.2	100	103	95
10	Right Front Door	97.0	94	96	101
11	Center Panel Right				
12	Right Rear Door	94.2	88	96	100
13	Right Back Panel	103.1	93	105	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat Head Rest - Missing - Yes / Rear Seat - Grime - Medium / Ceiling - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Overall Interior - Worn as per age - Yes	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Dent - Medium / (L) Front Door, Molding - Dent - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire, damaged foglamps, scratches on headlight and tail light