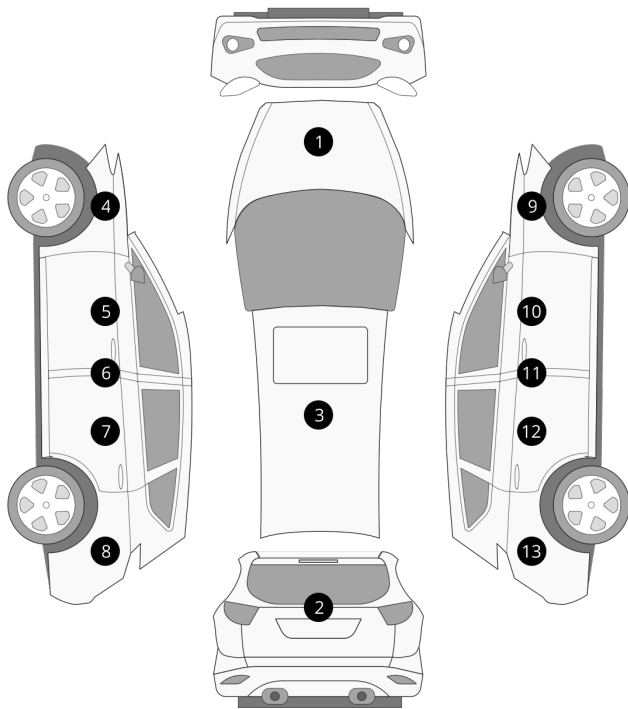


General Information

Date & Time: 21, Jul, 2025 15:44

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	28,073
Registration No.	NFN5325	Chassis No.	PA1B18F38L4112433
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



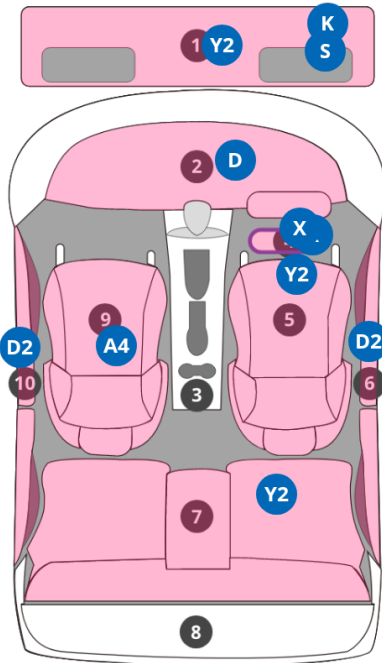
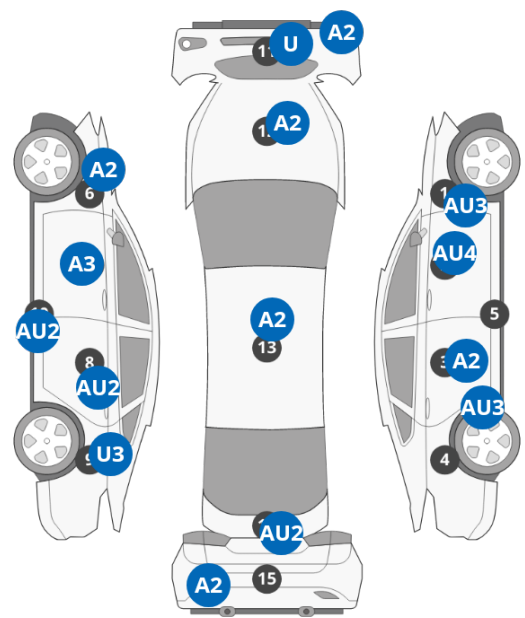
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.0	99	97	110
2	Boot Lid	100.5	96	103	103
3	Roof	87.7	96	81	84/91
4	Left Front Fender	87.1	90	85	86
5	Left Front Door	92.8	87	99	93
6	Center Panel Left				
7	Left Rear Door	93.7	96	103	83
8	Left Back Panel	100.8	104	100	99
9	Right Front Fender	86.7	86	86	89
10	Right Front Door	89.5	86	89	94
11	Center Panel Right				
12	Right Rear Door	91.0	91	89	94
13	Right Back Panel	90.5	89	88	94

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Cut, Crack - Large	Remarks (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, Spare tire. no warranty booklet, Jack and Tools , Crack tail light and scratch headlight and tail light, right door unusual sound when you open, possible flooded.