

General Information

Date & Time: 21, Jul, 2025 10:22

Make	Toyota	Model	Hilux
YOM	2019	Odo Meter Reading	75,312
Registration No.	NDA5185	Chassis No.	MR0GB8DD8J1419960
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Gray		

Body / Panel Condition



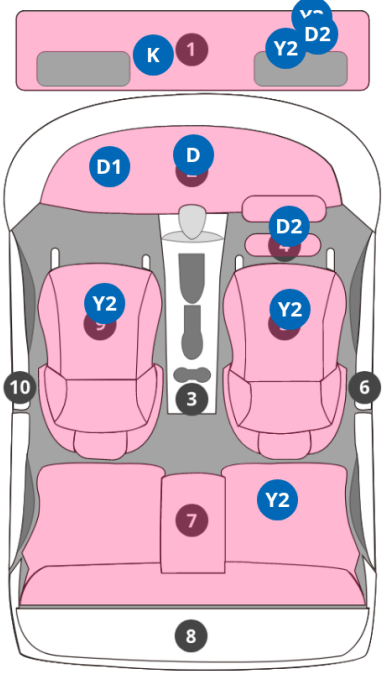
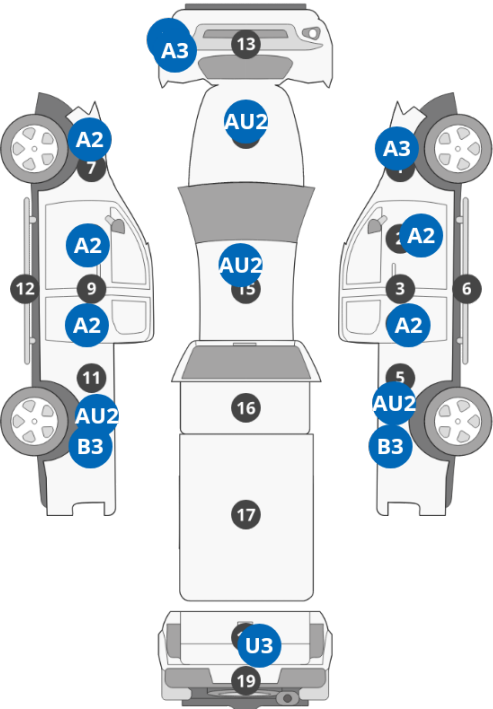
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	111	109	116
2	Boot Lid	97.9	100	92	102
3	Roof	120.5	122	113	125/122
4	Left Front Fender	100.0	104	106	90
5	Left Front Door	109.0	109	108	110
6	Center Panel Left				
7	Left Rear Door	103.4	110	105	95
8	Left Back Panel	108.5	99	104	123
9	Right Front Fender	122.3	127	118	122
10	Right Front Door	151.6	138	149	168
11	Center Panel Right				
12	Right Rear Door	99.1	96	98	103
13	Right Back Panel	106.5	117	103	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Medium / Overall Interior - Animal Hair - Yes / Sunvisor, Sunglass Holder - Worked - Small / Sunvisor, Sunglass Holder - Grime - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Glove Box - Worked - Minimal	Remarks Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Side Gate - Scratch & Dent - Small / Rear Gate - Dent - Medium / (R) Side Gate - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Side Gate - Modified - Medium / (L) Side Gate - Modified - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate, Jack and Spare tire, Incomplete Tools. no warranty booklet, no plate light, headlight low beam left side busted, scratch headlight and tail light. adhesive marks on vehicle.