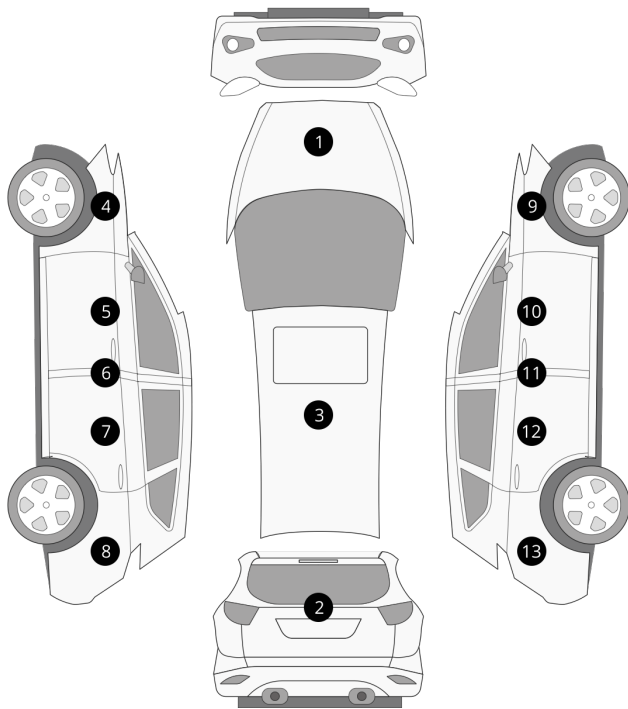


General Information

Date & Time: 21, Jul, 2025 08:42

Make	Suzuki	Model	APV
YOM	2024	Odo Meter Reading	4,303
Registration No.	NEY5504	Chassis No.	MHYDN71V7SJ400555
CC	1.6	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	Red		

Body / Panel Condition



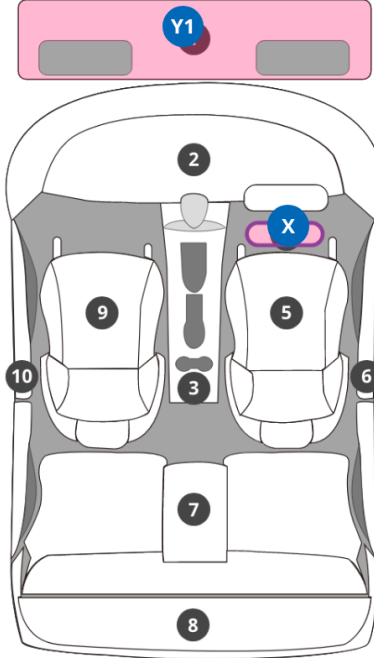
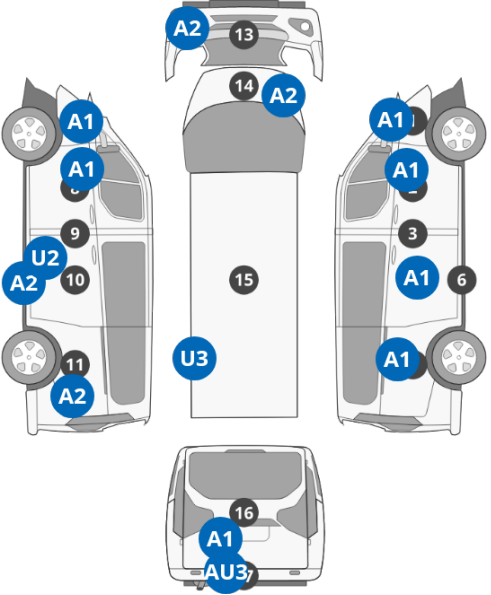
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	144.3	144	144	145
2	Boot Lid	98.8	101	97	99
3	Roof	124.2	153	150	103/91
4	Left Front Fender	149.0	149	146	152
5	Left Front Door	152.0	153	153	150
6	Center Panel Left	149.0	149	148	150
7	Left Rear Door	149.6	149	152	148
8	Left Back Panel	98.6	97	100	99
9	Right Front Fender	148.6	150	149	147
10	Right Front Door	152.0	159	150	147
11	Center Panel Right	93.5	94	93	93
12	Right Rear Door	151.0	154	152	147
13	Right Back Panel	94.2	95	91	97

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Front Panel - Scratch - Small / Roof - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, with warranty booklet, no jack and tools, with spare tire
