


General Information

Date & Time: 07, Aug, 2025 15:54

Make	Toyota	Model	Fortuner
YOM	2024	Odo Meter Reading	13,572
Registration No.	NFR2316	Chassis No.	MHFCB3GS9P0494874
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Gray		

Body / Panel Condition

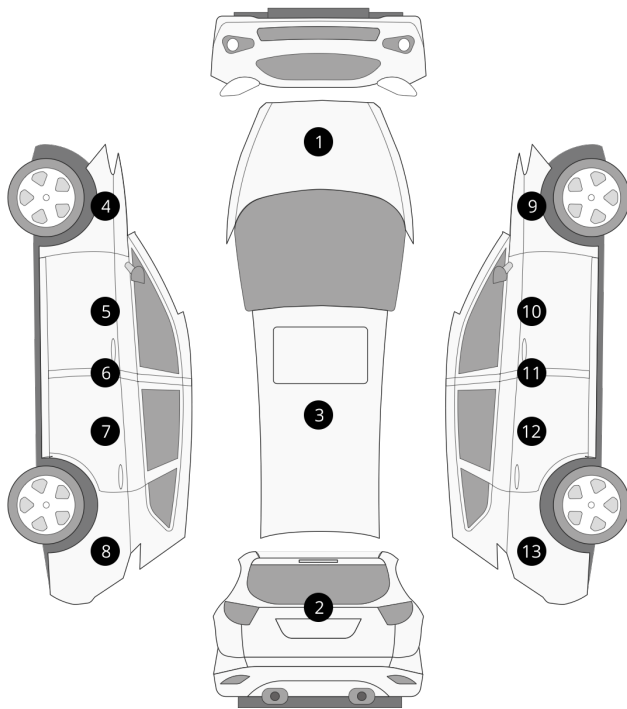


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	117	124	117
2	Boot Lid	106.3	100	112	107
3	Roof	149.0	116	107	227/146
4	Left Front Fender	116.0	115	113	120
5	Left Front Door	120.0	125	116	119
6	Center Panel Left				
7	Left Rear Door	107.0	110	108	103
8	Left Back Panel	118.0	126	114	114
9	Right Front Fender	115.6	126	110	111
10	Right Front Door	117.0	118	116	117
11	Center Panel Right				
12	Right Rear Door	105.9	100	106	112
13	Right Back Panel	118.0	119	112	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

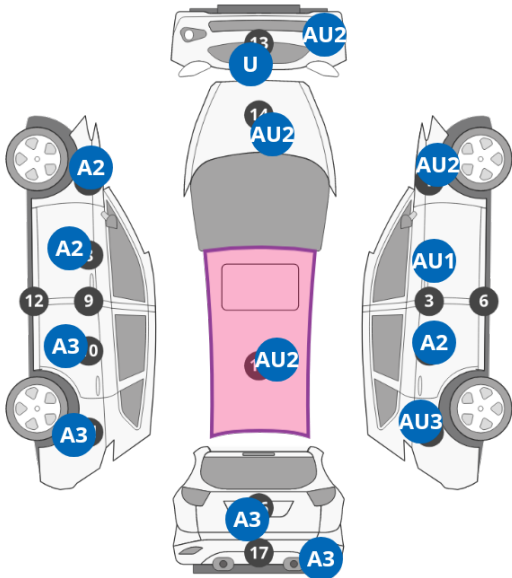Interior Evaluation : D  a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	Exterior Evaluation : D  A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (L) Front Floor Mat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks Roof - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Roof - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with spare tire/ with jack and tools/No spare key/seats with moulds/foul smell/with reverse camera