

General Information

Date & Time: 07, Aug, 2025 10:51

Make	Toyota	Model	Vios
YOM	2019	Odo Meter Reading	39,997
Registration No.	P1C582	Chassis No.	PA1B18F33K4082539
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



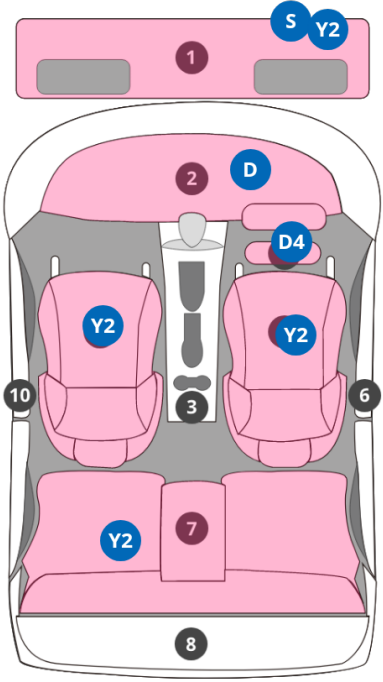
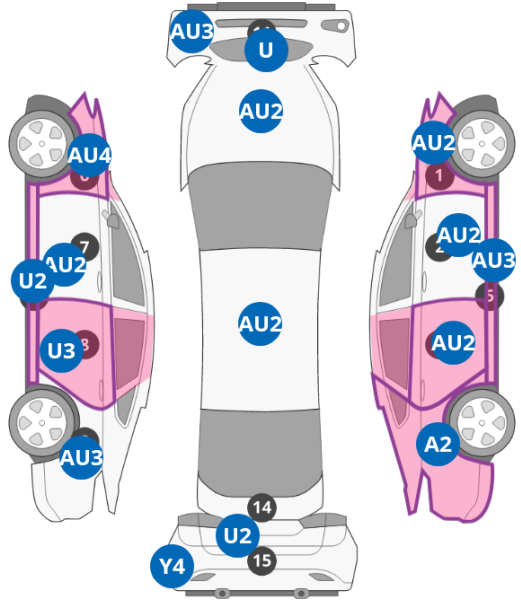
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	109	100	124
2	Boot Lid	119.3	109	118	131
3	Roof	142.2	100	93	97/280
4	Left Front Fender	104.3	103	102	108
5	Left Front Door	102.0	104	100	102
6	Center Panel Left				
7	Left Rear Door	103.3	106	103	101
8	Left Back Panel	120.6	121	119	122
9	Right Front Fender	179.6	244	144	151
10	Right Front Door	127.3	117	125	140
11	Center Panel Right				
12	Right Rear Door	101.3	100	100	104
13	Right Back Panel	127.3	142	135	105

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Large</p>	<p>Remarks (R) Step - Replaced - Yes / (R) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / Member (Bolted) - Dent - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : B	Functional Evaluation : E
<p>Remarks Front Cross Member Support - Condition of Welding ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Sparetire. No Tools and Jack and No LTO plate and warranty booklet, Scratch headlight and tail light. Busted Plate light, possible flooded, warning lamps on airbag, check engine And ABS. oil leak on engine, tow hook cover missing, trunk and lid tank cable need to replace. Unusual sound and vibration on engine.</p>