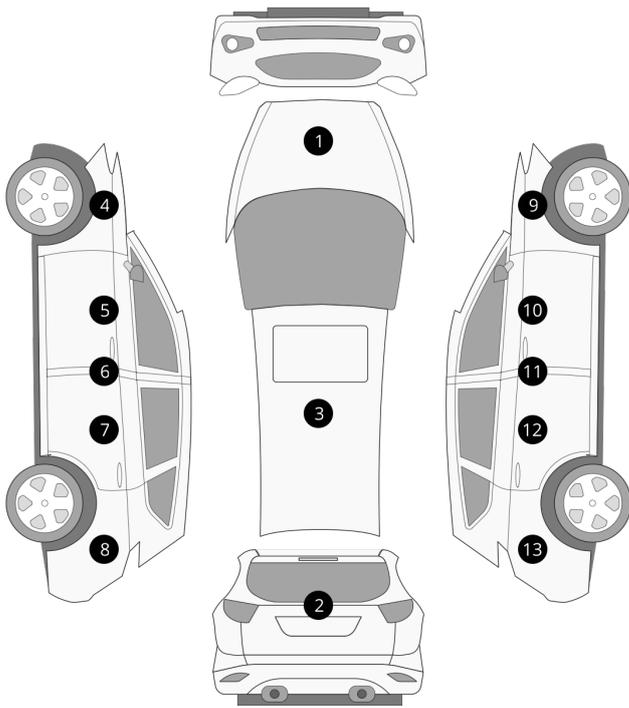


General Information

Date & Time: 12, Aug, 2025 12:29

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	28,960
Registration No.	DBN8868	Chassis No.	PA1B18F31P4234516
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



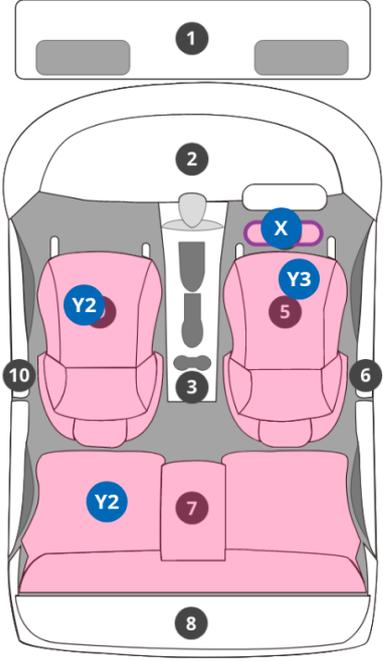
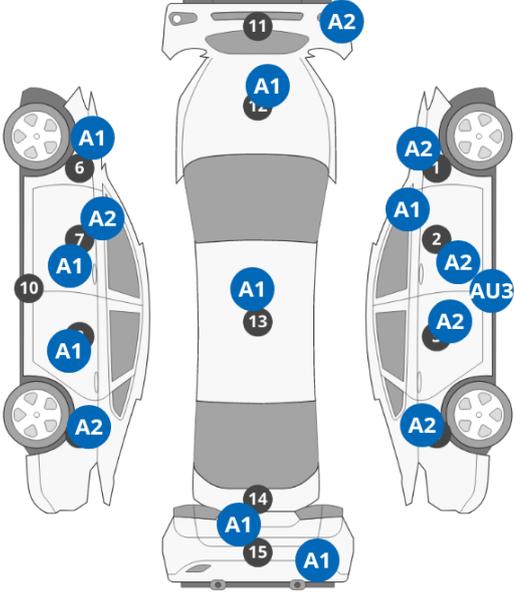
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	155.3	164	131	171
2	Boot Lid	140.0	126	145	149
3	Roof	122.7	124	143	115/109
4	Left Front Fender	132.3	129	130	138
5	Left Front Door	135.0	139	127	139
6	Center Panel Left				
7	Left Rear Door	130.6	138	126	128
8	Left Back Panel	129.6	138	132	119
9	Right Front Fender	141.0	147	134	142
10	Right Front Door	100.6	99	101	102
11	Center Panel Right				
12	Right Rear Door	101.2	108	96	100
13	Right Back Panel	129.0	107	159	121

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Missing - Yes / (L) Front Seat - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>No LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire, watermark stain, scratches on tail light and headlight.</p>