

General Information

Date & Time: 21, Jul, 2025 13:15

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	3,968
Registration No.	CCD2140	Chassis No.	MHKAA1BC8RJ017639
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



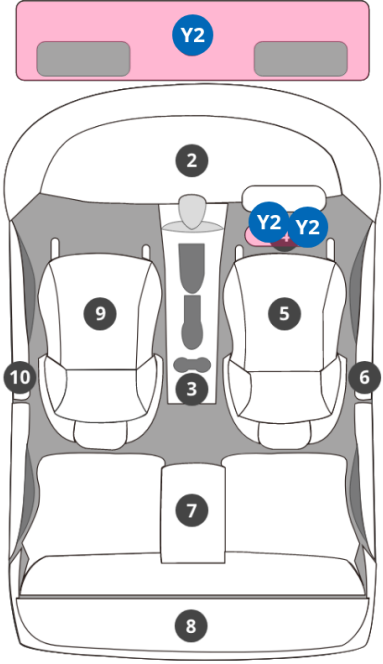
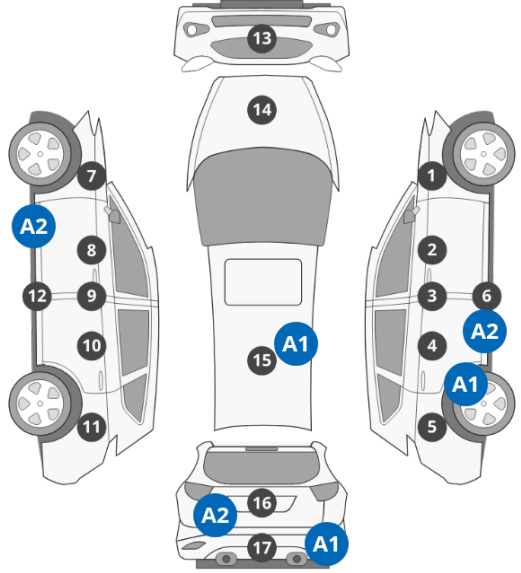
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.3	112	113	106
2	Boot Lid	75.6	75	79	74
3	Roof	74.4	77	73	77/71
4	Left Front Fender	89.8	84	97	89
5	Left Front Door	96.0	93	94	101
6	Center Panel Left				
7	Left Rear Door	89.2	94	90	84
8	Left Back Panel	88.6	92	85	89
9	Right Front Fender	79.8	82	82	76
10	Right Front Door	97.3	101	98	93
11	Center Panel Right				
12	Right Rear Door	94.2	82	92	108
13	Right Back Panel	84.5	83	85	86

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : A
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small</p>	<p>Remarks (L) Step, In-panel, Side Spoiler - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Roof - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With warranty booklet, spare tire, jack and seat cover. Without tools. 2 keys. With LTO plate.</p>