

General Information

Date & Time: 24, Jul, 2025 12:33

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	8,687
Registration No.	DBM6591	Chassis No.	PA1B18F3R4247076
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



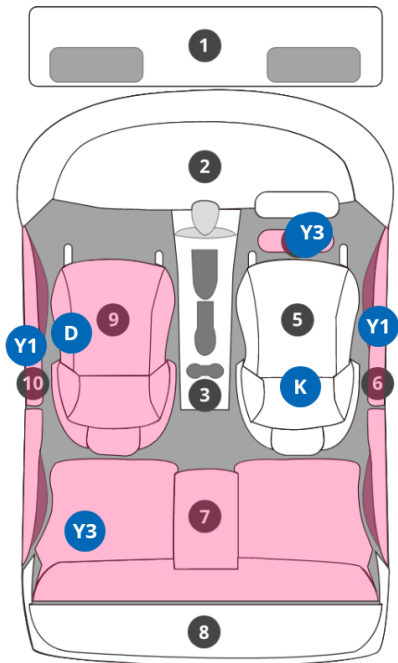
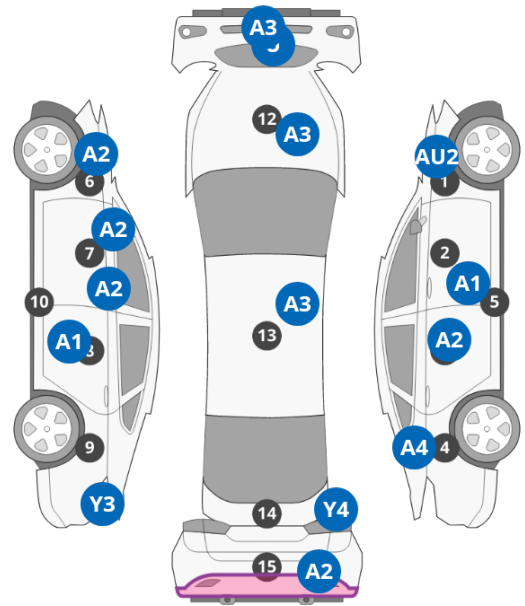
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	121	108	114
2	Boot Lid	335.3	435	278	293
3	Roof	106.2	115	107	97/106
4	Left Front Fender	101.9	102	108	96
5	Left Front Door	89.9	90	88	92
6	Center Panel Left				
7	Left Rear Door	98.8	103	102	92
8	Left Back Panel	209.6	222	187	220
9	Right Front Fender	102.6	102	103	103
10	Right Front Door	102.6	105	100	103
11	Center Panel Right				
12	Right Rear Door	110.3	102	102	127
13	Right Back Panel	113.0	117	111	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Worked - Large / Mat Other - Grime - Medium / (L) Front Seat - Worn - Yes / Overall Interior - Animal Hair - Yes / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal	Remarks (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / (L) Rear Fender, Molding - Crack, Gap - Medium / Roof - Scratch - Medium / Trunk Hood, Rear Gate - Crack, Gap - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack and tools, with spare tire and LTO PLATE, scratches on tail light, loose tail light