

General Information

Date & Time: 21, Jul, 2025 08:54

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	43,005
Registration No.	NFC3409	Chassis No.	MHKA4DF5FMJ053950
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



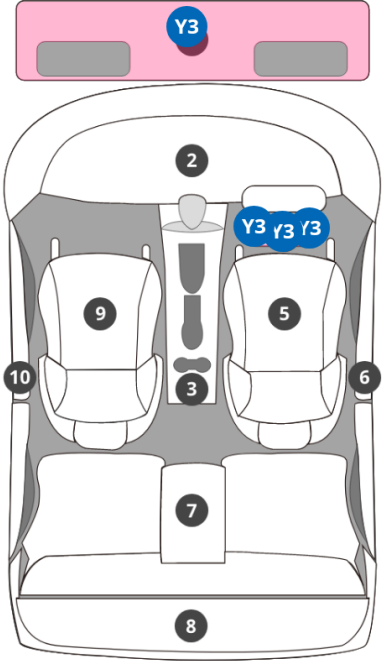
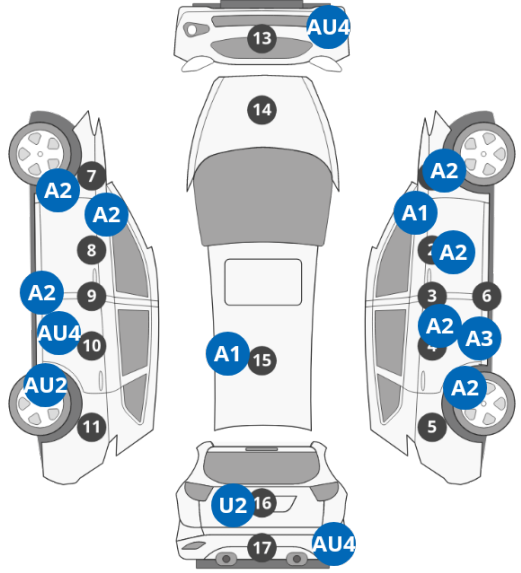
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	154.6	145	161	158
2	Boot Lid	92.7	92	96	90
3	Roof	82.2	74	100	81/74
4	Left Front Fender	221.6	231	226	208
5	Left Front Door	160.6	139	139	204
6	Center Panel Left				
7	Left Rear Door	159.0	173	152	152
8	Left Back Panel	128.3	136	123	126
9	Right Front Fender	128.0	122	127	135
10	Right Front Door	79.2	81	80	77
11	Center Panel Right				
12	Right Rear Door	75.1	75	76	75
13	Right Back Panel	98.2	103	95	97

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Medium</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes</p>

<p>Inspector Notes</p>
<p>Power window swith driver side issue. White smoke at exhaust. Double Registration of OR/CR. Without warranty booklet,jack and tools. With spare tire and leather seat cover. 1 key. with LTO plate.</p>