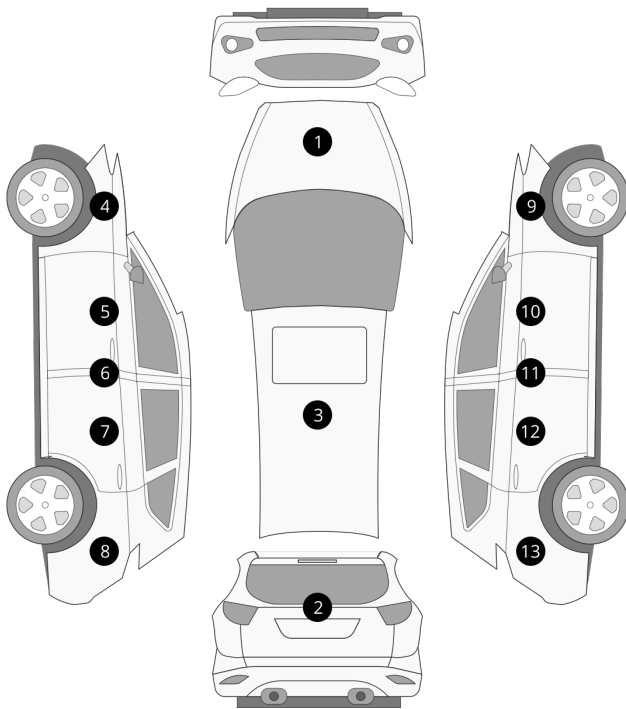


General Information

Date & Time: 22, Jul, 2025 15:29

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	12,042
Registration No.	DBQ9106	Chassis No.	PA1B18F37R4271508
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



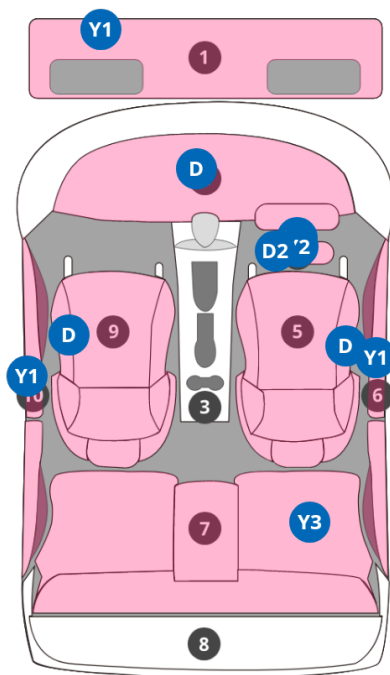
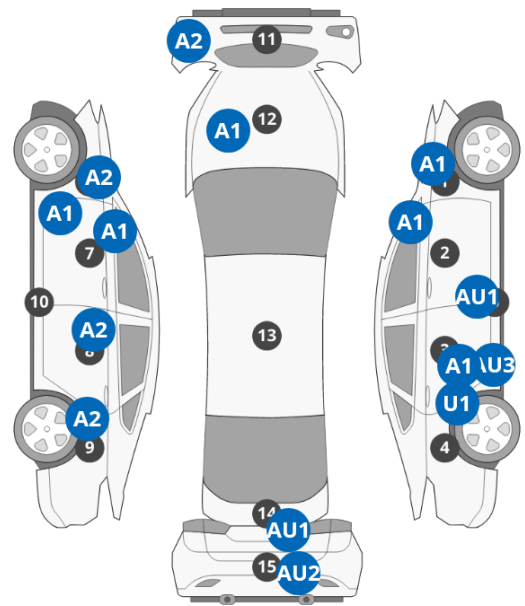
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	110	116	129
2	Boot Lid	118.6	115	124	117
3	Roof	103.5	104	104	100/106
4	Left Front Fender	101.0	101	102	100
5	Left Front Door	97.0	97	96	98
6	Center Panel Left				
7	Left Rear Door	100.0	110	100	90
8	Left Back Panel	109.3	121	105	102
9	Right Front Fender	101.6	101	99	105
10	Right Front Door	101.0	103	100	100
11	Center Panel Right				
12	Right Rear Door	105.0	99	103	113
13	Right Back Panel	103.0	102	104	103

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Small / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light