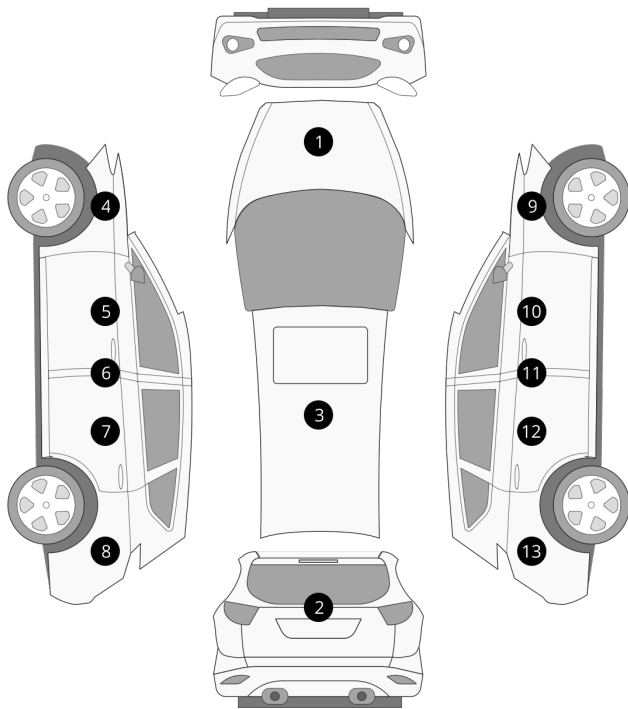


General Information

Date & Time: 22, Jul, 2025 15:19

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	9,191
Registration No.	EAJ6687	Chassis No.	MHKAA1BC9RJ029167
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



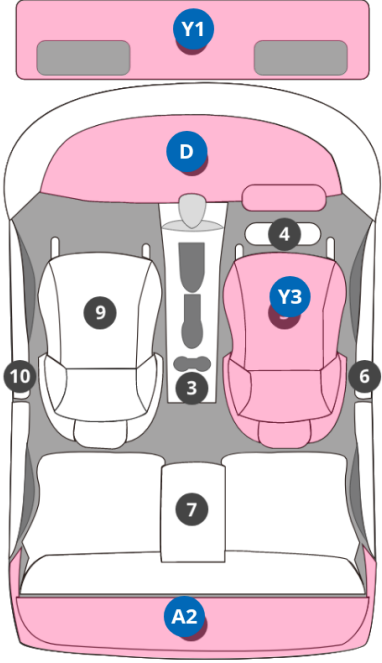
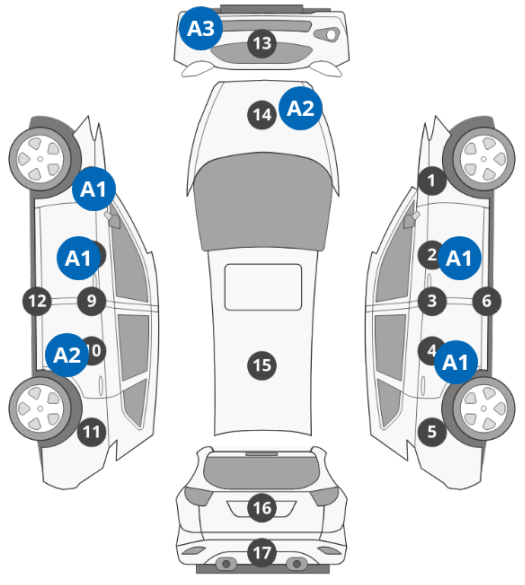
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.0	120	128	121
2	Boot Lid	88.0	83	93	89
3	Roof	96.5	86	77	135/88
4	Left Front Fender	99.8	91	102	106
5	Left Front Door	107.6	102	108	113
6	Center Panel Left				
7	Left Rear Door	96.7	106	97	87
8	Left Back Panel	89.8	97	87	85
9	Right Front Fender	96.1	105	99	84
10	Right Front Door	119.6	124	121	114
11	Center Panel Right				
12	Right Rear Door	105.1	94	104	117
13	Right Back Panel	95.4	97	96	93

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Medium / Ceiling - Grime - Minimal	Remarks (R) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/wit jack and tools/warranty booklet