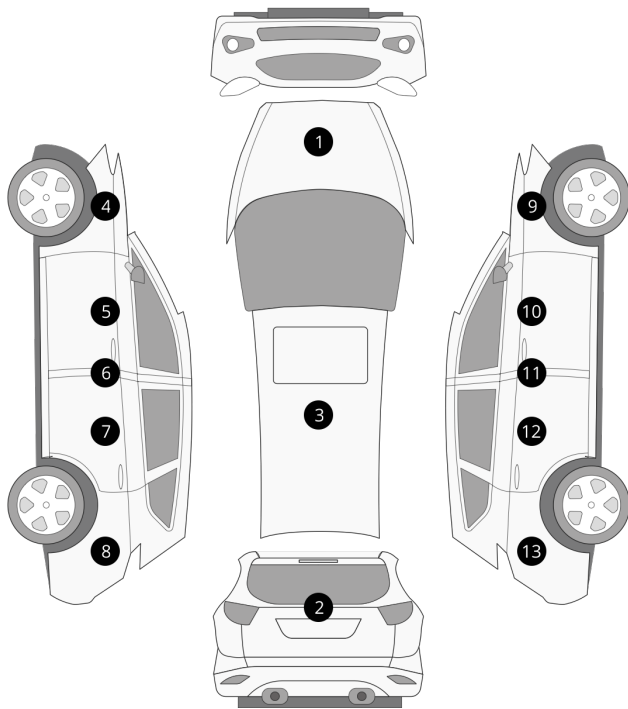


General Information

Date & Time: 23, Jul, 2025 10:31

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	20,775
Registration No.	NFF8313	Chassis No.	PA1B18F32P4232659
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



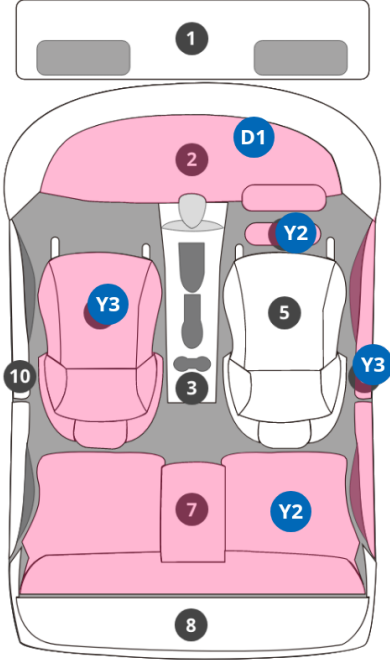
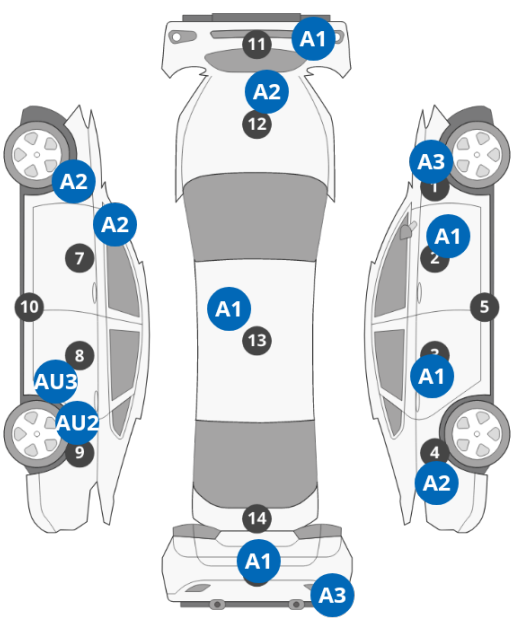
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	110	108	109
2	Boot Lid	106.2	110	95	114
3	Roof	104.8	114	105	98/102
4	Left Front Fender	102.0	106	98	102
5	Left Front Door	105.0	103	102	110
6	Center Panel Left				
7	Left Rear Door	104.0	115	102	95
8	Left Back Panel	101.2	108	101	95
9	Right Front Fender	98.4	100	94	101
10	Right Front Door	117.3	115	128	109
11	Center Panel Right				
12	Right Rear Door	103.5	100	100	111
13	Right Back Panel	106.6	107	107	106

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Mat Other - Grime - Small / Dashboard - Loose, Deformed - Minimal	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire, damaged tail light