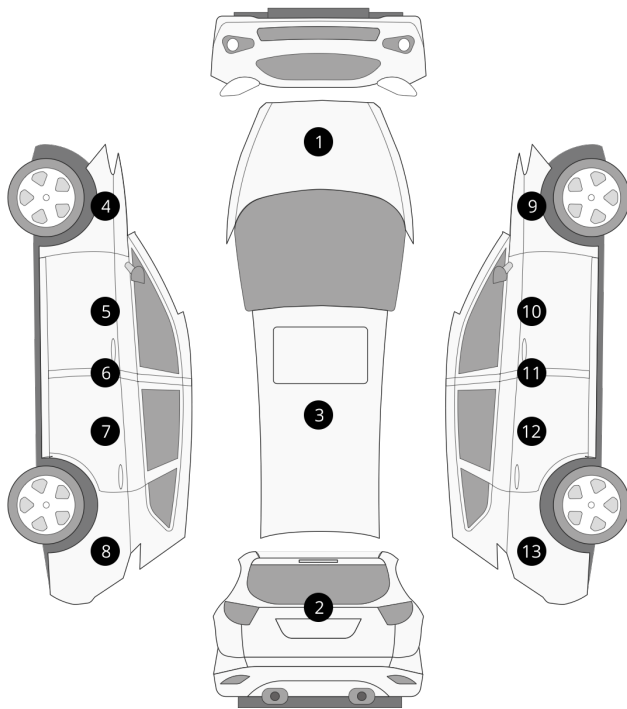


General Information

Date & Time: 23, Jul, 2025 13:07

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	21,562
Registration No.	NFR5849	Chassis No.	PA1B18F3XR4255397
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



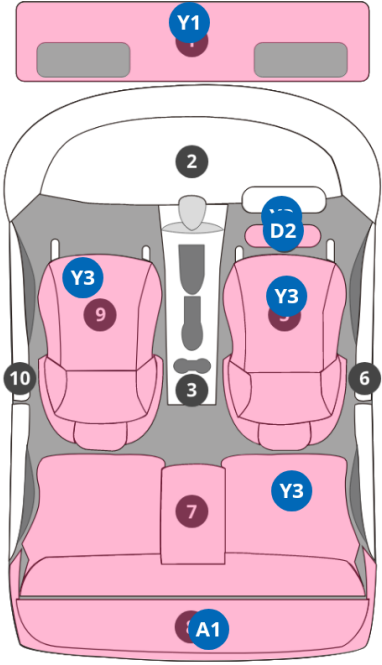
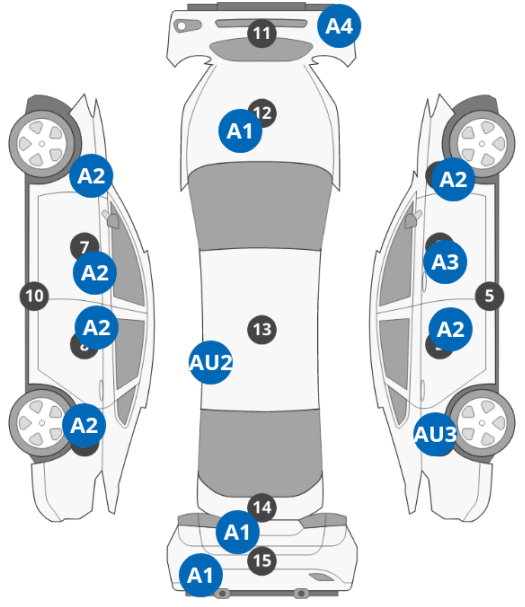
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.3	115	101	115
2	Boot Lid	109.6	115	100	114
3	Roof	101.4	111	96	103/96
4	Left Front Fender	99.9	101	99	100
5	Left Front Door	99.2	101	93	104
6	Center Panel Left				
7	Left Rear Door	107.7	122	103	98
8	Left Back Panel	106.6	116	104	100
9	Right Front Fender	98.3	100	95	100
10	Right Front Door	105.6	100	113	104
11	Center Panel Right				
12	Right Rear Door	102.3	100	95	112
13	Right Back Panel	102.9	107	96	106

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / (R) Front Seat - Grime - Medium / Ceiling - Grime - Minimal / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with LTO plate , no warranty booklet, with jack and tools, with spare tire