

General Information

Date & Time: 23, Jul, 2025 10:52

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	13,901
Registration No.	NKA8363	Chassis No.	PA1B18F3XR4247302
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



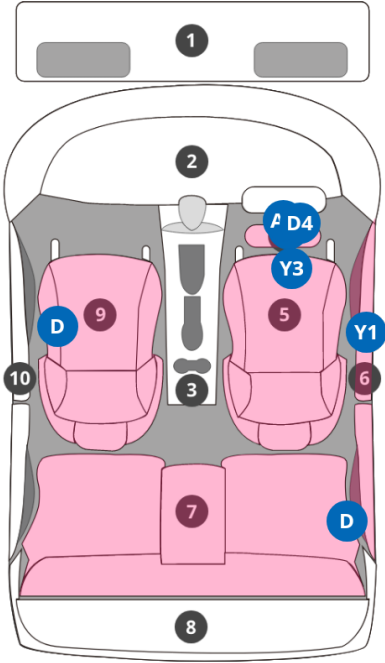
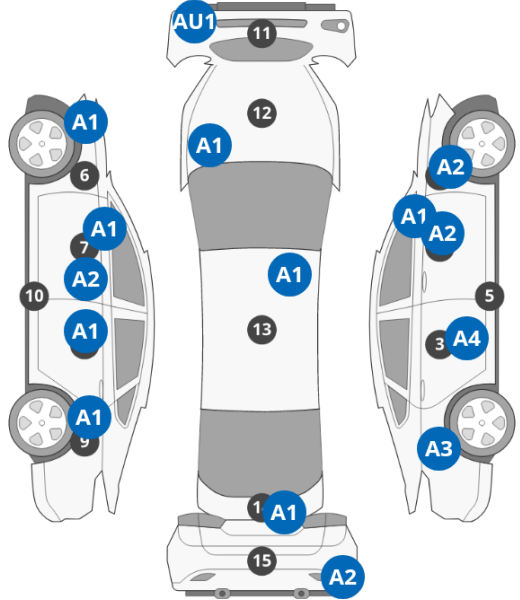
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	117	106	113
2	Boot Lid	101.9	96	100	110
3	Roof	105.4	104	106	99/113
4	Left Front Fender	95.4	100	94	93
5	Left Front Door	97.2	94	96	102
6	Center Panel Left				
7	Left Rear Door	98.8	116	95	86
8	Left Back Panel	107.4	114	109	99
9	Right Front Fender	100.3	104	96	101
10	Right Front Door	107.0	114	103	104
11	Center Panel Right				
12	Right Rear Door	103.6	95	100	116
13	Right Back Panel	105.6	102	104	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Rear Seat - Worn - Yes / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Minimal / (L) Front Floor Mat - Worked - Large	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
no warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on headlight, trunk floormat missing