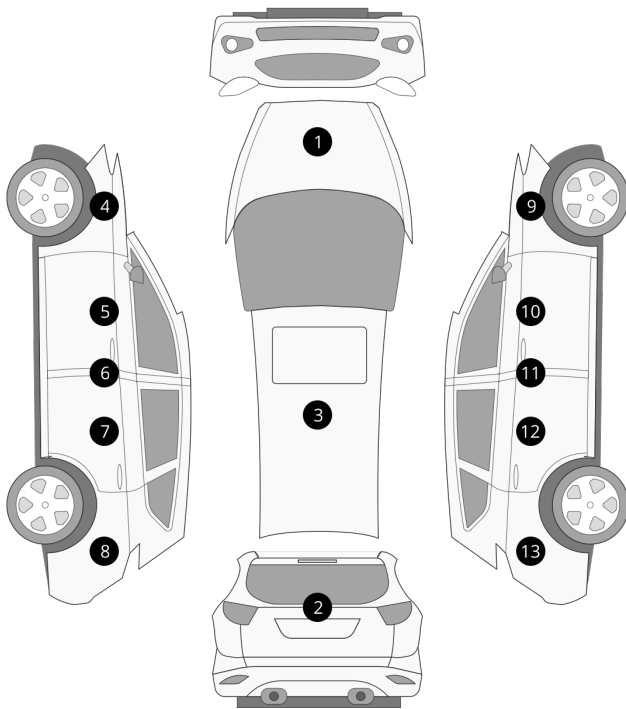


General Information

Date & Time: 22, Jul, 2025 13:55

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	13,314
Registration No.	NKI9888	Chassis No.	PA1B18F39R4262714
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



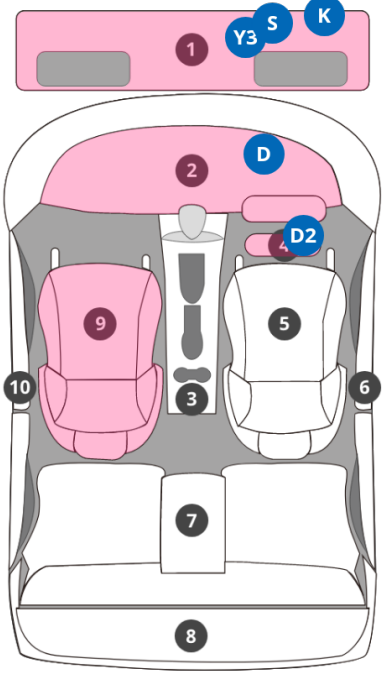
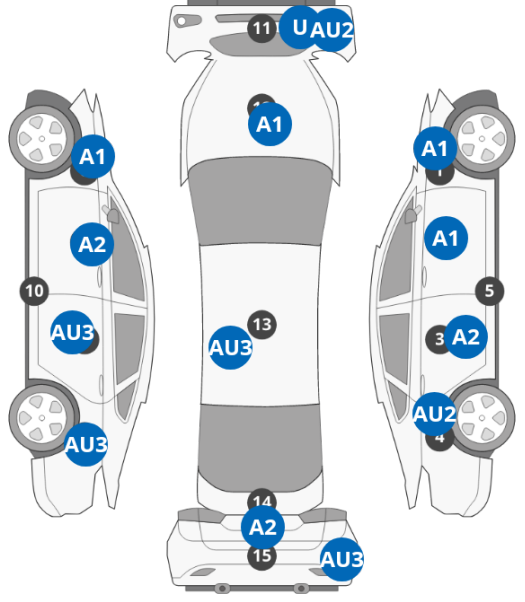
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	123	103	116
2	Boot Lid	111.0	107	112	114
3	Roof	105.4	112	106	105/99
4	Left Front Fender	99.4	104	99	95
5	Left Front Door	104.3	103	105	105
6	Center Panel Left				
7	Left Rear Door	108.6	117	107	102
8	Left Back Panel	118.0	129	116	109
9	Right Front Fender	142.3	132	146	149
10	Right Front Door	97.3	103	94	95
11	Center Panel Right				
12	Right Rear Door	103.2	94	104	112
13	Right Back Panel	108.3	106	106	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Medium / Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat Knobs - Stuck - Yes	Remarks Member (Bolted) - Dent - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Seat Belts - Issue - Yes

Inspector Notes

With LTO plate and Sparetire. no warranty booklet, Jack and Tools. scratch headlight and tail light. adhesive marks on trunk and back glass.