

## General Information

Date & Time: 23, Jul, 2025 09:38

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	32,432
<b>Registration No.</b>	NFP5892	<b>Chassis No.</b>	PA1B18F31N4191793
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blackish Red Mica		

## Body / Panel Condition



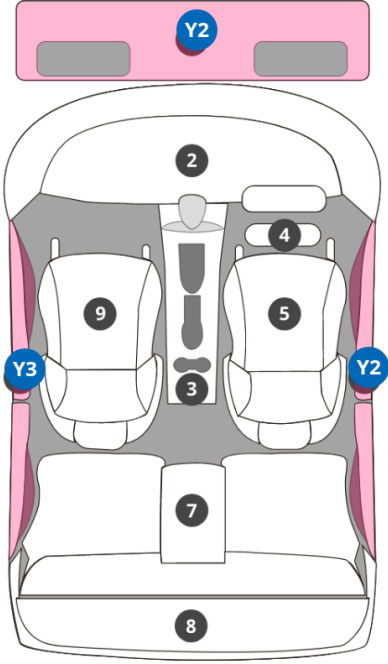
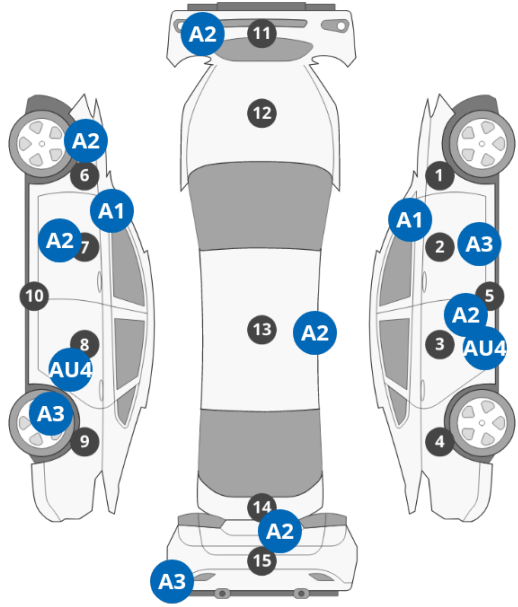
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.6	98	95	103
2	Boot Lid	107.3	104	104	114
3	Roof	80.5	87	77	79/80
4	Left Front Fender	90.6	99	86	87
5	Left Front Door	95.1	92	97	96
6	Center Panel Left				
7	Left Rear Door	100.2	103	100	98
8	Left Back Panel	101.3	108	96	100
9	Right Front Fender	91.7	95	88	92
10	Right Front Door	93.0	92	90	98
11	Center Panel Right				
12	Right Rear Door	104.3	107	104	102
13	Right Back Panel	98.8	99	101	97

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Trim - Grime - Small / Ceiling - Grime - Small / (L) Front Trim - Grime - Medium</p>	<p><b>Remarks</b> (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Mirror - Scratch - Minimal / Roof - Scratch - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Large</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>E</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>NON MOVING VEHICLE due of starting issue. starter issue. aircon issue. oil warning lamp,battery warning lamp and steering warning lamp. worn front tires. Without warranty booklet and tools. With spare tire,jack and seat cover. 1 key. With LTO plate.</p>