

## General Information

Date & Time: 24, Jul, 2025 15:26

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	11,246
<b>Registration No.</b>	CCG4970	<b>Chassis No.</b>	PA1B18F32R4270119
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



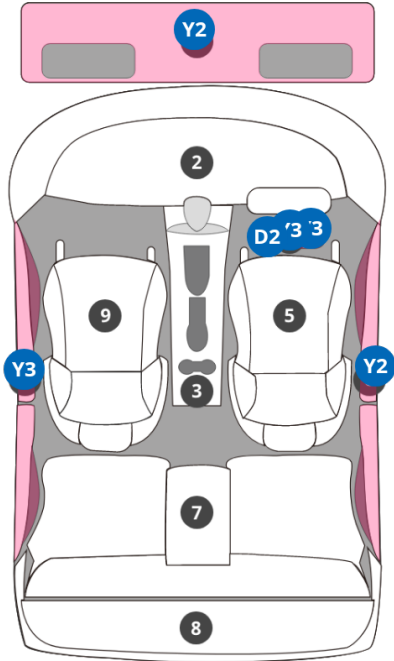
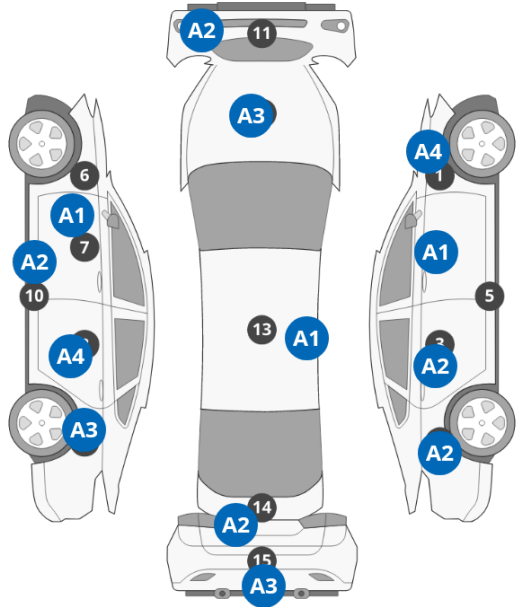
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.5	99	103	106
2	Boot Lid	102.7	98	101	109
3	Roof	97.8	102	99	95/96
4	Left Front Fender	91.9	95	90	91
5	Left Front Door	104.0	101	103	108
6	Center Panel Left				
7	Left Rear Door	110.0	120	109	101
8	Left Back Panel	105.9	112	106	100
9	Right Front Fender	101.9	99	98	109
10	Right Front Door	93.1	89	96	94
11	Center Panel Right				
12	Right Rear Door	97.3	97	94	101
13	Right Back Panel	106.3	101	105	113

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	<b>B</b>	<b>Exterior Evaluation :</b>	<b>D</b>
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small</p>		<p><b>Remarks</b> (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Large / Roof - Scratch - Minimal</p>	
<b>Frame Evaluation :</b>	<b>A</b>	<b>Functional Evaluation :</b>	<b>A</b>
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Defects not found</p>	

<b>Inspector Notes</b>
Without warranty booklet. with Spare tire,jack,tools and seat cover. 3 keys. With LTO plate.