

General Information

Date & Time: 24, Jul, 2025 08:51

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	23,769
Registration No.	CCG3870	Chassis No.	PA1B18F39R4267069
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



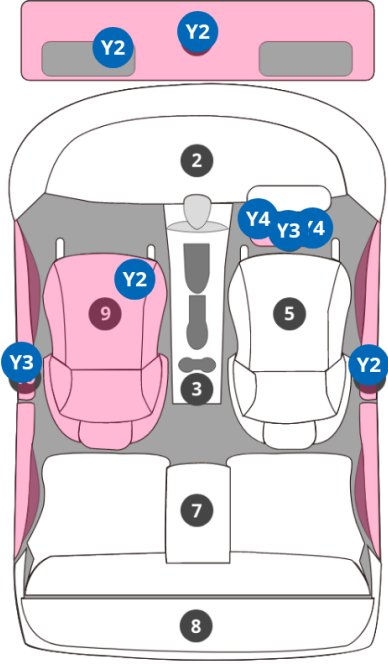
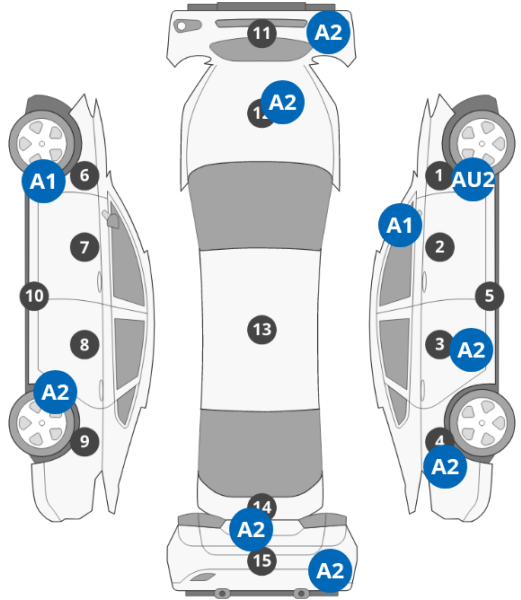
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.1	97	102	101
2	Boot Lid	104.3	97	108	108
3	Roof	93.1	97	90	91/95
4	Left Front Fender	89.6	95	87	87
5	Left Front Door	151.3	151	147	156
6	Center Panel Left				
7	Left Rear Door	141.3	145	144	135
8	Left Back Panel	175.3	184	174	168
9	Right Front Fender	94.8	91	95	99
10	Right Front Door	97.3	100	100	92
11	Center Panel Right				
12	Right Rear Door	99.1	100	95	102
13	Right Back Panel	99.2	97	92	109

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Large / Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Large / (L) Front Seat - Grime - Small / Sunvisor, Sunglass Holder - Grime - Small</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Different steering wheel. Interior panel below the steering wheel partially missing. ABS warning lamp. Traction control switch issue. Aircon not working. Interior light front issue. With warranty booklet,, spare tire,jack and seat cover. incomplete tools. 1 key. With LTO plate.</p>