

General Information

Date & Time: 24, Jul, 2025 09:32

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	44,994
Registration No.	NFD1897	Chassis No.	PA18F38M4167389
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



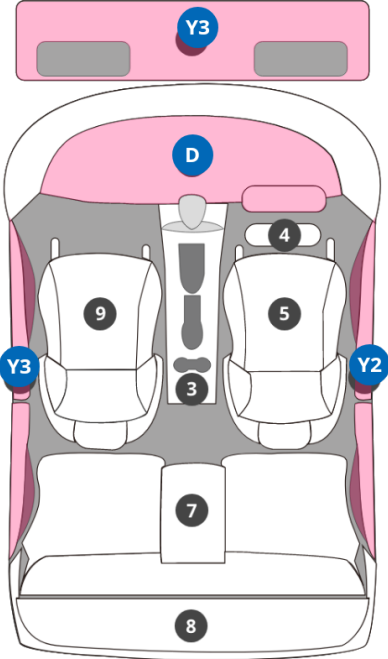
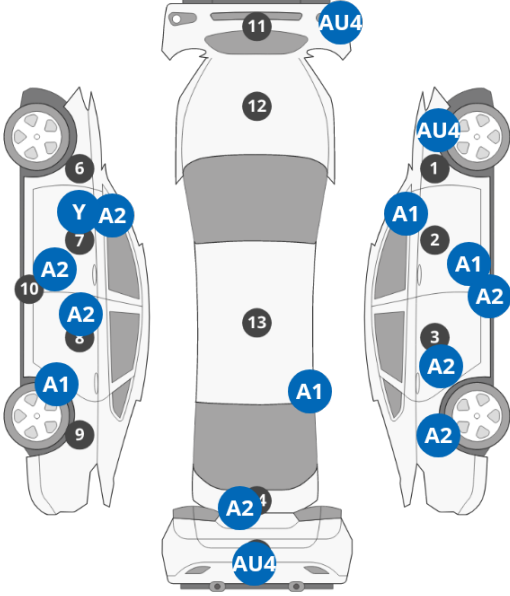
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.9	93	101	100
2	Boot Lid	100.9	96	102	105
3	Roof	87.9	95	83	86/88
4	Left Front Fender	93.0	100	91	88
5	Left Front Door	92.0	93	98	85
6	Center Panel Left				
7	Left Rear Door	91.2	89	89	96
8	Left Back Panel	103.4	97	106	107
9	Right Front Fender	82.0	83	80	83
10	Right Front Door	92.6	93	96	89
11	Center Panel Right				
12	Right Rear Door	93.8	90	95	97
13	Right Back Panel	97.6	93	94	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Medium</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Mirror - Crack - Damaged / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>Rusted bolts at seat railings. Left side mirror loose. With dashcam. Without warranty booklet. With Spare tire,jack,tools,and seat cover. 2 keys. With LTO plate.</p>