

General Information

Date & Time: 24, Jul, 2025 09:58

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	22,150
Registration No.	NHS5917	Chassis No.	P1B18F30R4263976
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



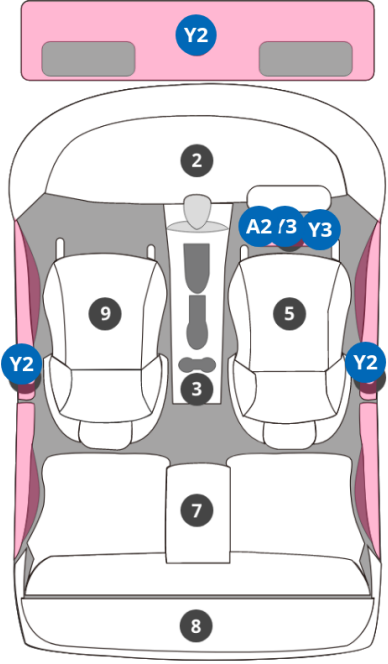
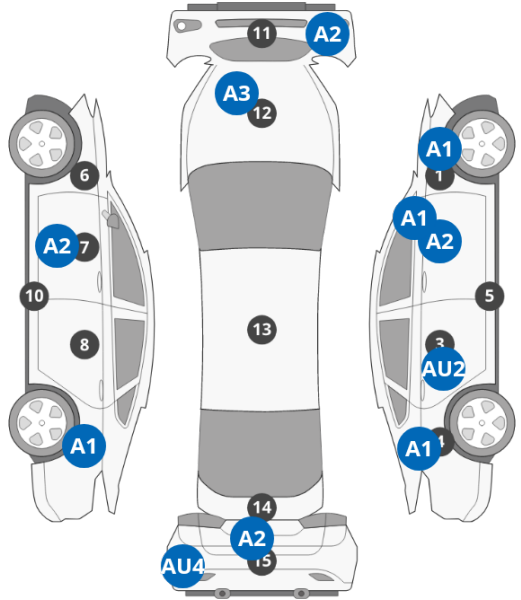
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.7	97	100	99
2	Boot Lid	102.0	93	105	108
3	Roof	97.1	102	98	93/96
4	Left Front Fender	95.3	100	95	91
5	Left Front Door	92.0	92	90	94
6	Center Panel Left				
7	Left Rear Door	100.5	103	105	94
8	Left Back Panel	101.8	112	100	94
9	Right Front Fender	91.7	96	85	94
10	Right Front Door	92.4	92	92	94
11	Center Panel Right				
12	Right Rear Door	89.1	85	90	92
13	Right Back Panel	95.7	94	93	100

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small</p>	<p>Remarks (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Adhesive mark at taillight. With warranty booklet,sparetire,jack,tools and sest cover. 1 key. With LTO plate.</p>