

General Information

Date & Time: 24, Jul, 2025 13:36

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	5,640
Registration No.	CCG5138	Chassis No.	PA1B18F31R4273108
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



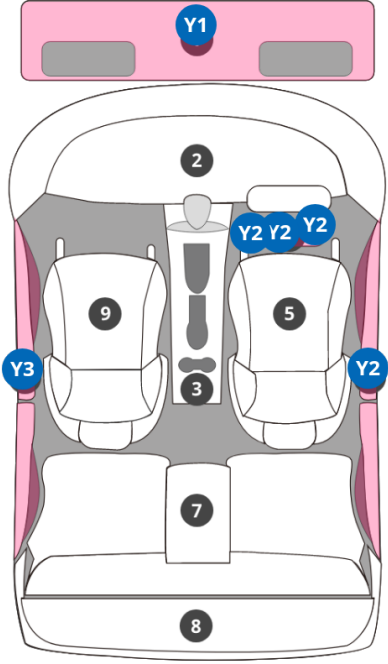
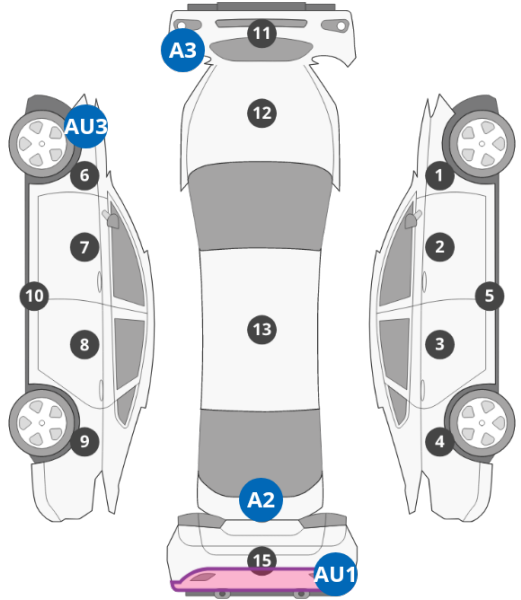
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.7	100	97	102
2	Boot Lid	99.2	95	98	105
3	Roof	91.7	97	90	88/91
4	Left Front Fender	90.2	92	89	89
5	Left Front Door	94.2	92	91	100
6	Center Panel Left				
7	Left Rear Door	98.0	104	98	93
8	Left Back Panel	109.3	127	103	98
9	Right Front Fender	90.1	89	90	92
10	Right Front Door	93.2	100	89	91
11	Center Panel Right				
12	Right Rear Door	95.4	86	96	105
13	Right Back Panel	99.1	100	92	105

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Minimal / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Small</p>	<p>Remarks (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With warranty booklet, spare tire, jack, tools and seat cover. 3 keys. With LTO plate.</p>