

General Information

Date & Time: 25, Jul, 2025 15:29

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	58,079
Registration No.	NEV7317	Chassis No.	PA1B18F37M4156606
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



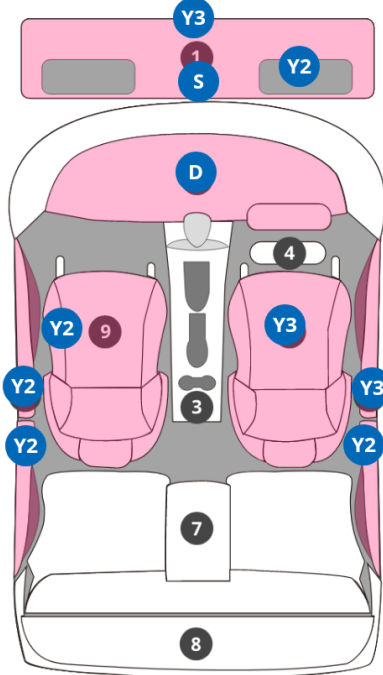
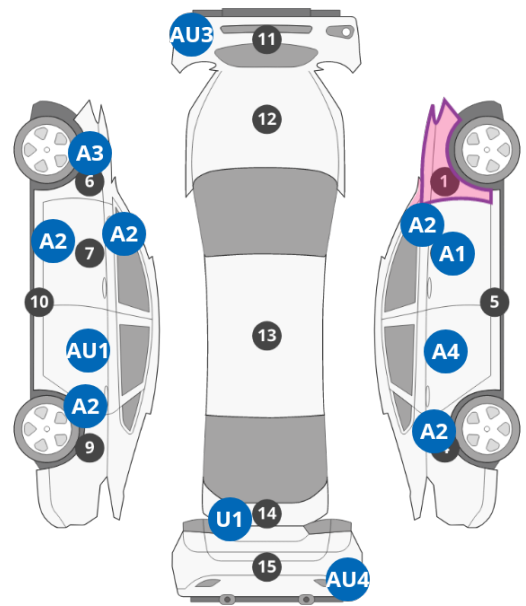
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.9	90	105	108
2	Boot Lid	108.3	108	106	111
3	Roof	97.9	105	89	92/106
4	Left Front Fender	92.8	98	91	89
5	Left Front Door	100.3	100	102	99
6	Center Panel Left				
7	Left Rear Door	96.2	99	97	93
8	Left Back Panel	112.3	108	109	120
9	Right Front Fender	86.6	83	86	91
10	Right Front Door	149.6	164	141	144
11	Center Panel Right				
12	Right Rear Door	151.6	136	137	182
13	Right Back Panel	102.7	103	90	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / Ceiling - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Small</p>	<p>Remarks (R) Rear Door - Repair Traces - Yes / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / (R) Front Wheel, Cover - Cap Missing - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Possible flooding. Wet carpet. Headlight lowbeam missing. After market mags. Without warranty booklet,jack,tools,and seat cover. With spare tire. 1 key. With LTO plate.</p>