


General Information

Date & Time: 01, Aug, 2025 16:05

Make	Toyota	Model	Vios
YOM	2017	Odo Meter Reading	115,782
Registration No.	DAD9496	Chassis No.	PA1B19F30H4027297
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition

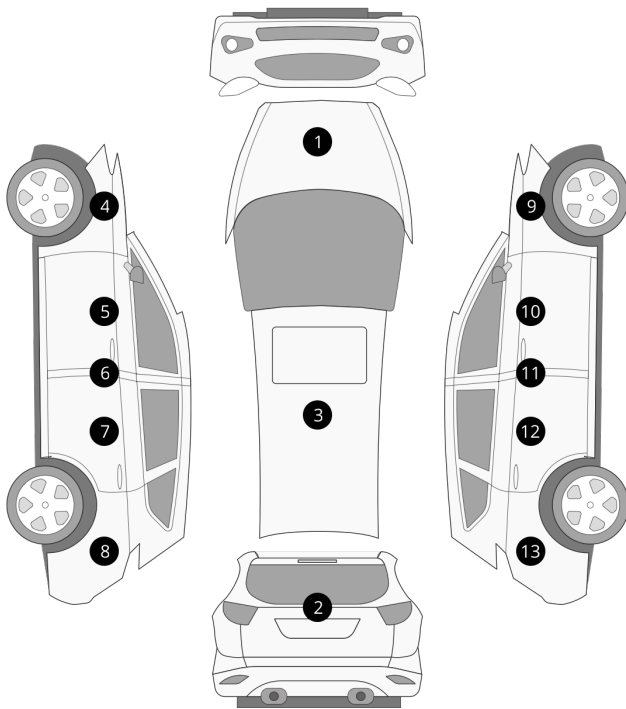


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	118	116	108
2	Boot Lid	86.6	89	86	86
3	Roof	107.6	95	106	106/124
4	Left Front Fender	124.6	115	120	139
5	Left Front Door	126.0	129	124	125
6	Center Panel Left				
7	Left Rear Door	126.0	124	123	131
8	Left Back Panel	143.3	159	135	136
9	Right Front Fender	127.3	140	122	120
10	Right Front Door	128.6	121	130	135
11	Center Panel Right				
12	Right Rear Door	130.6	137	130	125
13	Right Back Panel	136.3	139	124	146

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

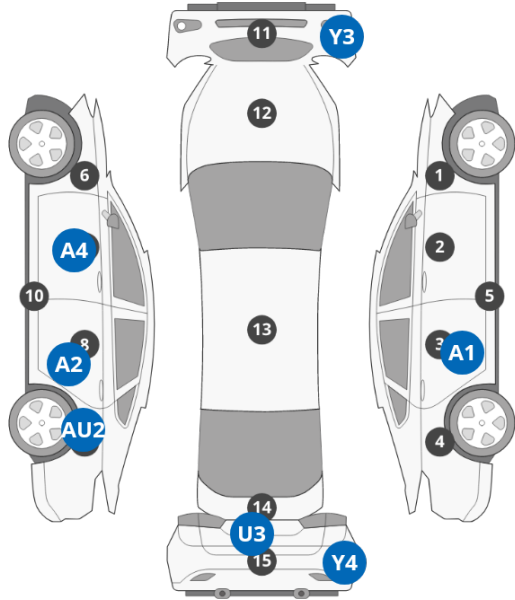Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small	Remarks Rear Bumper, Lamps, Panels - Crack, Gap - Large / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (L) Front Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Medium / Overall Exterior - Faded(Color, Gloss) - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/ with warranty booklet/with jack and incomplete tools/ No reverse camera/faded color around the vehicle/Dome light issue/heads unit issue/audio not working