

General Information

Date & Time: 01, Aug, 2025 10:01

Make	Toyota	Model	Vios
YOM	2018	Odo Meter Reading	37,320
Registration No.	DAL9009	Chassis No.	PA1B13F33J4062967
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



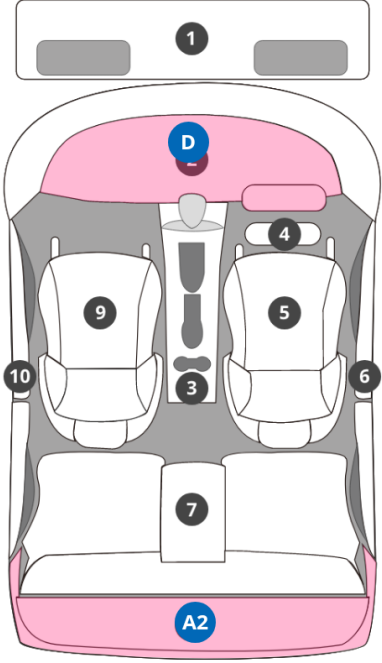
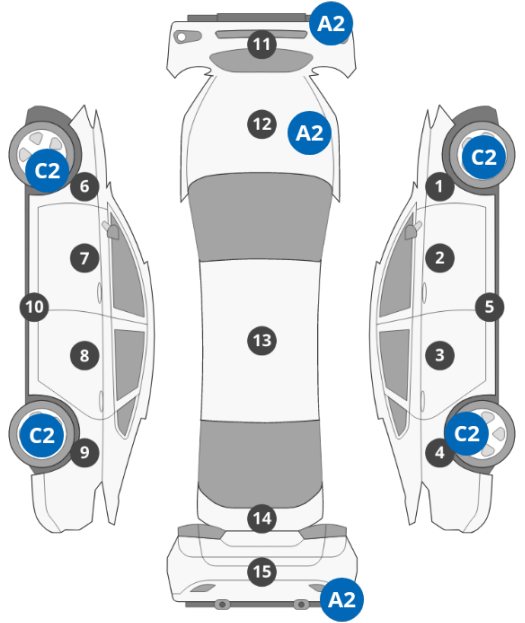
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	115	113	117
2	Boot Lid	122.0	119	119	128
3	Roof	100.9	102	98	95/108
4	Left Front Fender	107.6	104	108	111
5	Left Front Door	111.6	119	105	111
6	Center Panel Left				
7	Left Rear Door	110.3	115	110	106
8	Left Back Panel	128.3	141	122	122
9	Right Front Fender	125.0	135	121	119
10	Right Front Door	123.0	122	117	130
11	Center Panel Right				
12	Right Rear Door	116.0	104	117	127
13	Right Back Panel	124.6	121	125	128

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small / Overall Exterior - Faded(Color, Gloss) - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack and tools/with warranty booklet/plate light issue/fog light issue/No reverse camera/rear bumper left and right sensor missing/tail light right side with small crack