

General Information

Date & Time: 04, Aug, 2025 15:33

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	6,059
Registration No.	CCD2310	Chassis No.	PA1B18F3XR4244948
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



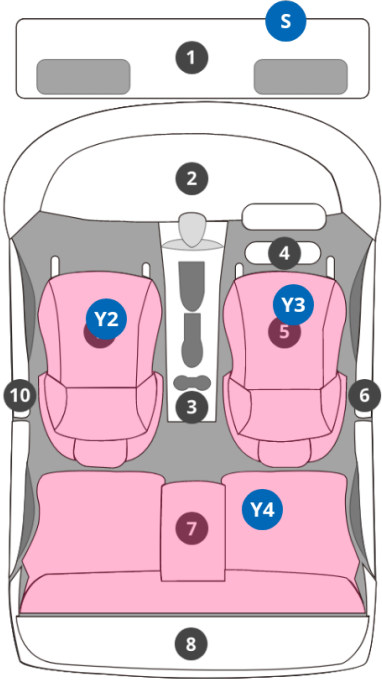
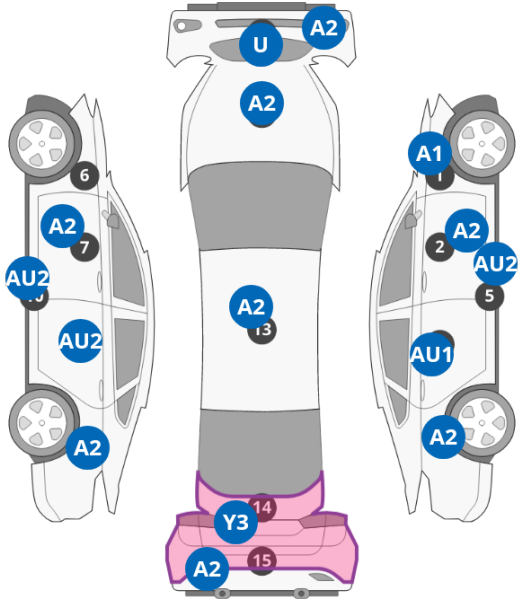
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	118	105	115
2	Boot Lid	210.6	211	207	214
3	Roof	103.5	103	105	101/105
4	Left Front Fender	106.3	101	104	114
5	Left Front Door	106.3	105	110	104
6	Center Panel Left				
7	Left Rear Door	105.0	107	104	104
8	Left Back Panel	121.6	127	126	112
9	Right Front Fender	101.6	104	100	101
10	Right Front Door	110.0	106	111	113
11	Center Panel Right				
12	Right Rear Door	114.3	113	112	118
13	Right Back Panel	112.3	109	108	120

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / Overall Interior - Smell - Yes / (L) Front Seat - Grime - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO PLATE, No warranty booklet, Jack and Sparetire, Tools, scratch headlight and tail light. HPG RECOVER