

General Information

Date & Time: 01, Aug, 2025 13:39

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	43,566
Registration No.	DBN4714	Chassis No.	PA1B18F31P4232135
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



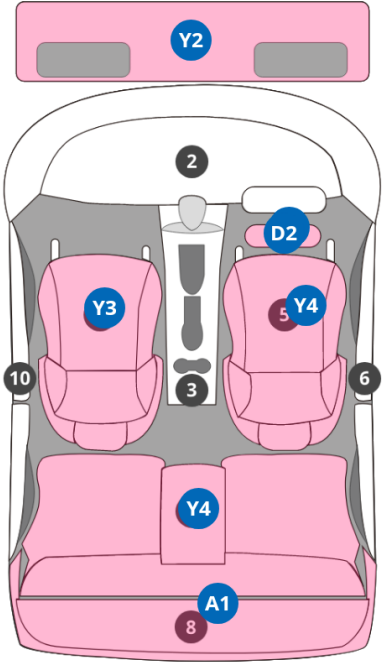
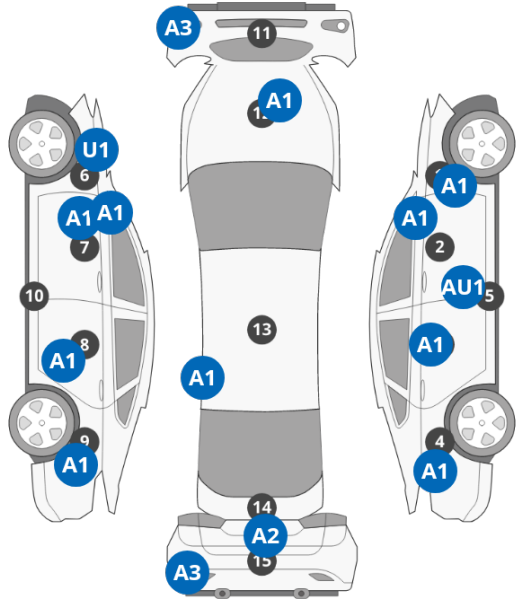
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	117	110	114
2	Boot Lid	122.3	117	116	134
3	Roof	112.2	109	113	115/112
4	Left Front Fender	107.0	109	102	110
5	Left Front Door	110.3	119	101	111
6	Center Panel Left				
7	Left Rear Door	113.0	119	109	111
8	Left Back Panel	115.0	123	113	109
9	Right Front Fender	107.6	114	100	109
10	Right Front Door	112.0	110	106	120
11	Center Panel Right				
12	Right Rear Door	113.6	106	108	127
13	Right Back Panel	122.6	132	113	123

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire