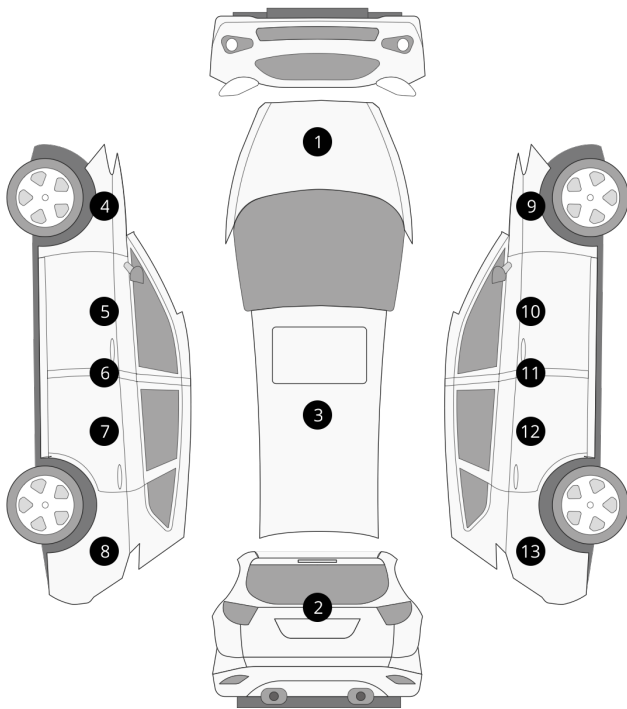


General Information

Date & Time: 30, Jul, 2025 16:41

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	15,082
Registration No.	DBO4060	Chassis No.	MHKAA1BC7PJ011411
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



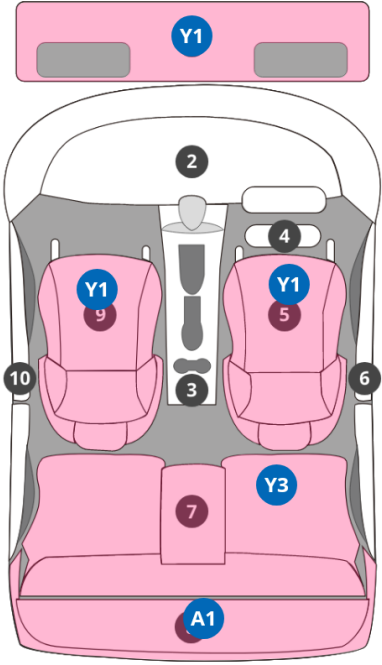
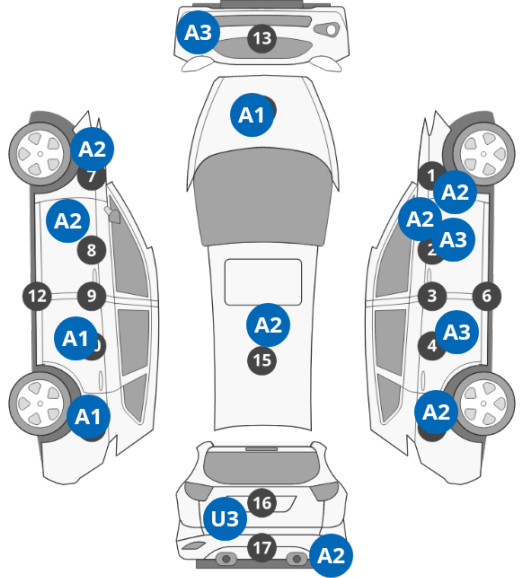
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	124	115	117
2	Boot Lid	93.6	94	95	92
3	Roof	99.1	116	99	93/88
4	Left Front Fender	100.5	104	112	86
5	Left Front Door	120.6	113	118	131
6	Center Panel Left				
7	Left Rear Door	112.6	124	106	108
8	Left Back Panel	92.7	92	92	94
9	Right Front Fender	106.4	121	103	95
10	Right Front Door	123.6	133	115	123
11	Center Panel Right				
12	Right Rear Door	117.0	114	107	130
13	Right Back Panel	102.3	104	103	100

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (R) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with warranty booklet, no jack and tools, with spare tire, reverse sensor malfunction