

General Information

Date & Time: 04, Aug, 2025 08:28

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	15,743
Registration No.	NEY6694	Chassis No.	PA1B18F38R426275
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



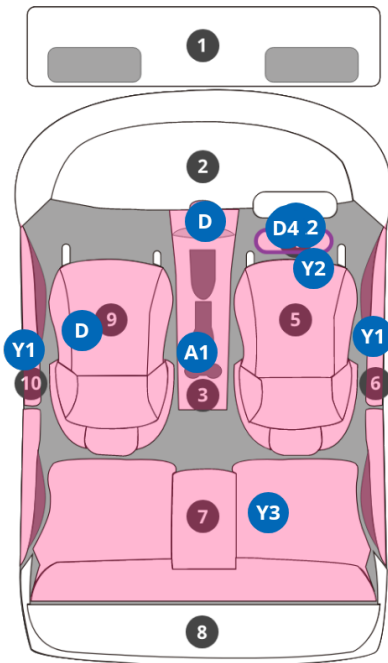
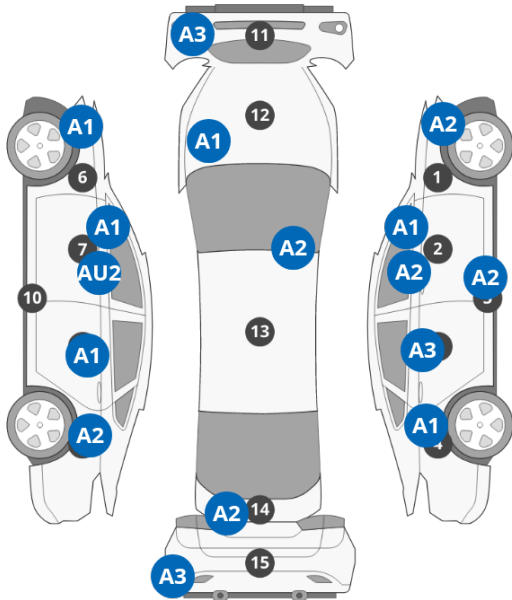
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	109	106	111
2	Boot Lid	104.4	98	110	105
3	Roof	102.9	112	106	95/99
4	Left Front Fender	95.8	102	96	90
5	Left Front Door	99.1	100	99	99
6	Center Panel Left				
7	Left Rear Door	102.3	108	108	91
8	Left Back Panel	107.3	122	106	94
9	Right Front Fender	99.7	96	98	105
10	Right Front Door	102.1	105	107	95
11	Center Panel Right				
12	Right Rear Door	106.3	100	111	108
13	Right Back Panel	101.2	107	97	100

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C		Exterior Evaluation : C	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Rear Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Carpet - Worked - Minimal / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Large / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Minimal		Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Spare Key - Issue - Unexist	

Inspector Notes

no warranty booklet, with jack, no tools, with spare tire, no LTO plate, scratches on tail light, HPG RECOVER, LTO apprehension total fine 15,000.