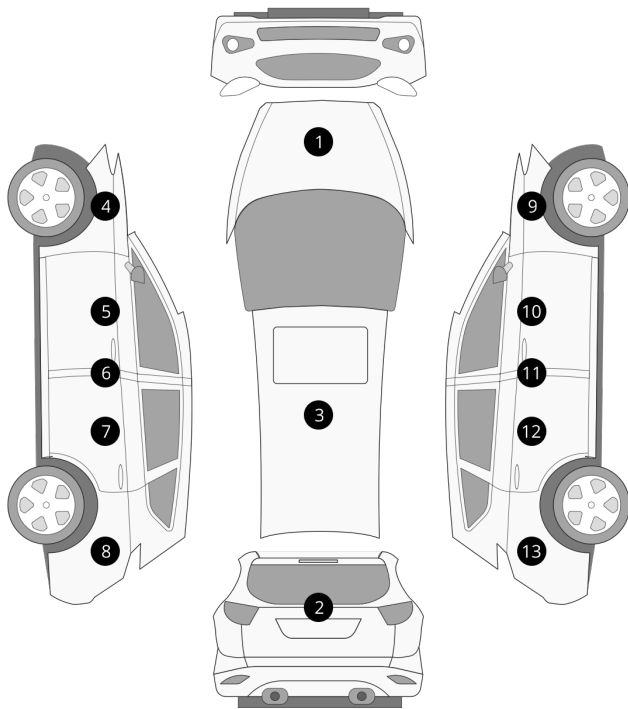


General Information

Date & Time: 30, Jul, 2025 18:39

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	22,238
Registration No.	NFC8923	Chassis No.	PA1B18F30P4220624
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



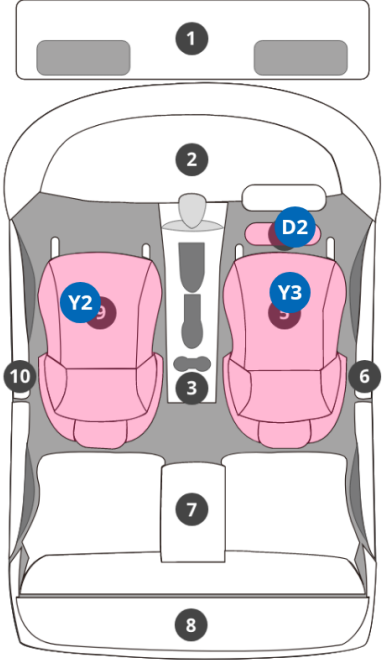
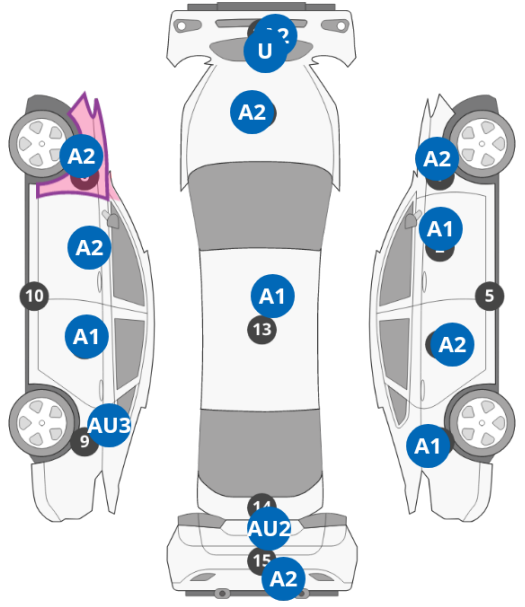
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	121	100	109
2	Boot Lid	109.0	113	105	109
3	Roof	100.6	105	102	104/92
4	Left Front Fender	361.0	163	522	398
5	Left Front Door	125.3	130	119	127
6	Center Panel Left				
7	Left Rear Door	105.6	104	105	108
8	Left Back Panel	111.5	97	123	115
9	Right Front Fender	100.7	99	104	99
10	Right Front Door	103.2	107	100	103
11	Center Panel Right				
12	Right Rear Door	110.0	105	105	120
13	Right Back Panel	110.3	109	105	117

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Member (Bolted) - Dent - Yes / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate and Sparetire, Jack and Incomplete Tools. no warranty booklet, scratch headlight and tail light.