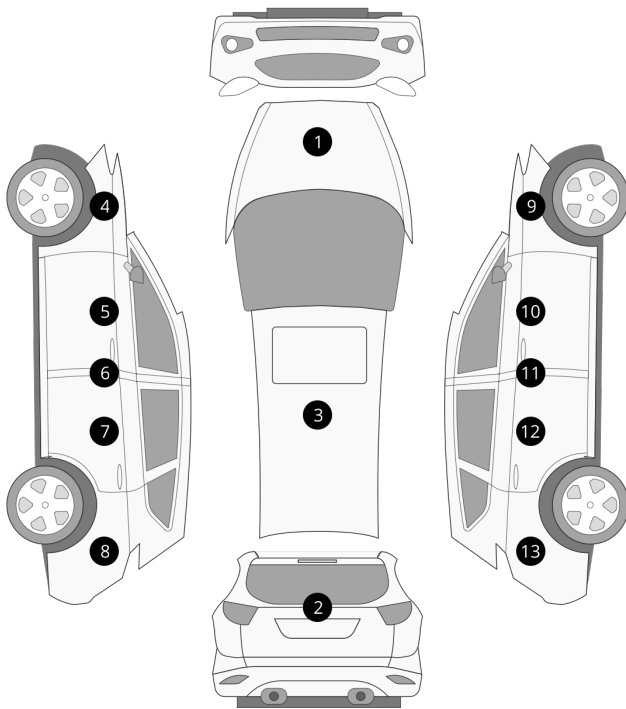


General Information

Date & Time: 06, Aug, 2025 15:16

Make	Toyota	Model	Fortuner
YOM	2024	Odo Meter Reading	12,493
Registration No.	NHM9739	Chassis No.	MHFCB3GS6R0495242
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	White		

Body / Panel Condition



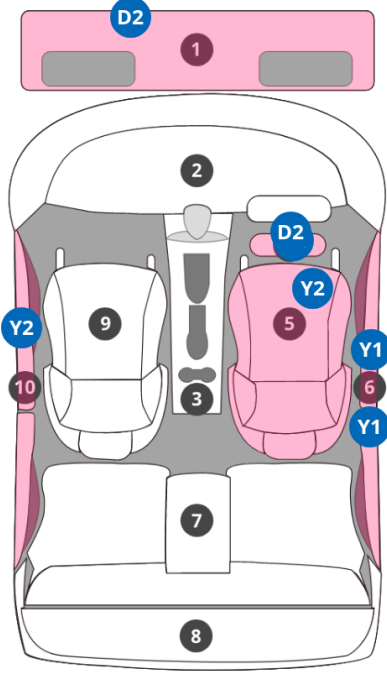
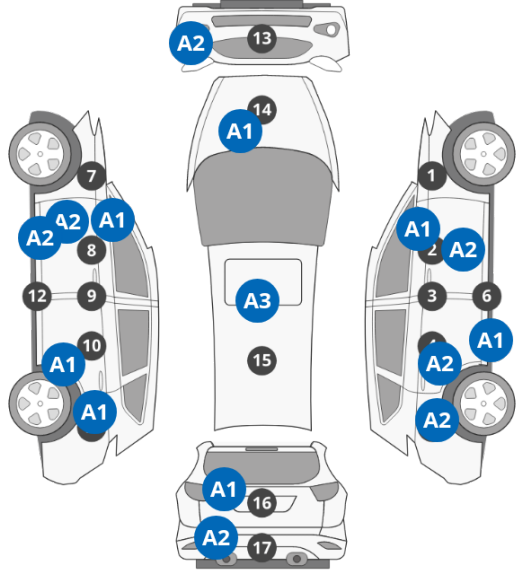
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.0	115	124	121
2	Boot Lid	103.6	99	115	97
3	Roof	116.2	126	129	108/102
4	Left Front Fender	142.0	161	143	122
5	Left Front Door	188.3	184	134	247
6	Center Panel Left				
7	Left Rear Door	98.6	104	91	101
8	Left Back Panel	111.0	107	109	117
9	Right Front Fender	110.6	113	109	110
10	Right Front Door	98.2	99	94	102
11	Center Panel Right				
12	Right Rear Door	96.3	97	92	100
13	Right Back Panel	114.3	123	103	117

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Small / (R) Front Seat - Grime - Small / (R) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Ceiling - Crinkle - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Front Door - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

no warranty booklet, no jack, with tools, with spare tire, no LTO plate, R/HPG Recover, scratches on tail light,