

General Information

Date & Time: 30, Jul, 2025 12:57

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	16,827
Registration No.	NKD7212	Chassis No.	PA1B18F35R4258708
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



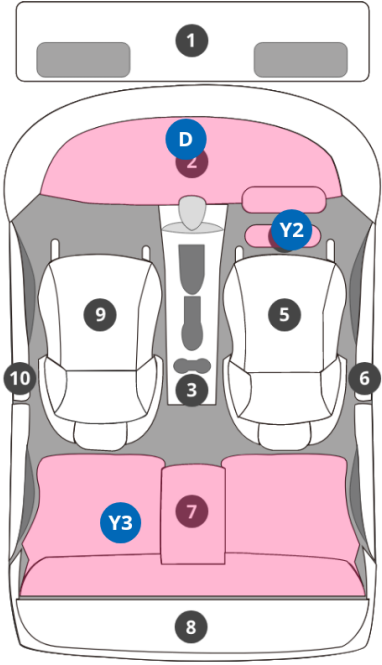
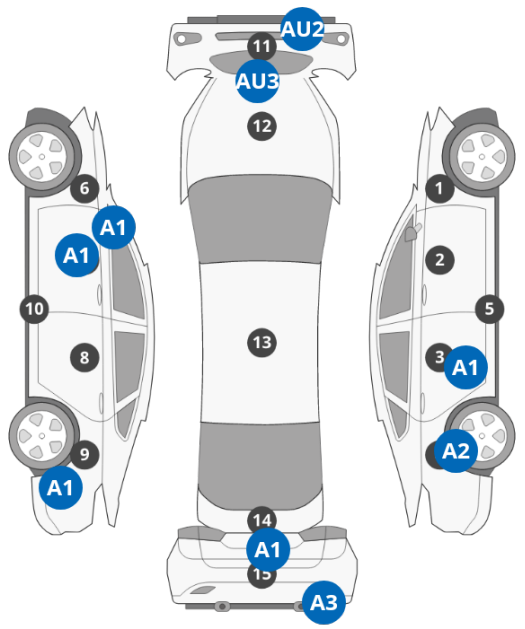
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	125	117	124
2	Boot Lid	112.6	117	105	116
3	Roof	115.5	131	113	113/105
4	Left Front Fender	113.0	103	110	126
5	Left Front Door	112.0	112	108	116
6	Center Panel Left				
7	Left Rear Door	116.6	127	119	104
8	Left Back Panel	112.6	114	113	111
9	Right Front Fender	113.3	115	111	114
10	Right Front Door	109.3	111	106	111
11	Center Panel Right				
12	Right Rear Door	110.3	103	115	113
13	Right Back Panel	110.0	105	109	116

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Grime - Small / Rear Seat - Grime - Medium	Remarks Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack and incomplete tools/wit warranty booklet/with reverse camera