

General Information

Date & Time: 16, Nov, 2024 17:53

Make	Toyota	Model	Vios
YOM	2023	Mileage	11,520
Registration No.	EAG3267	Chassis No.	PA1B18F38P4206308
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



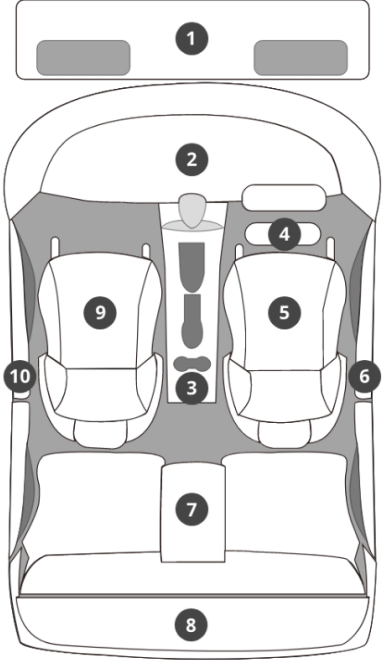
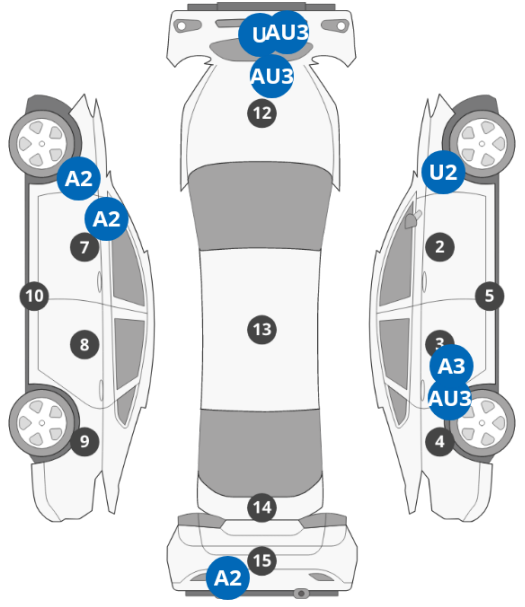
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.3	122	121	121
2	Boot Lid	109.3	110	105	113
3	Roof	100.5	100	101	96/105
4	Left Front Fender	98.8	99	100	98
5	Left Front Door	106.3	103	108	108
6	Center Panel Left				
7	Left Rear Door	108.0	113	106	105
8	Left Back Panel	109.3	112	108	108
9	Right Front Fender	99.4	98	99	101
10	Right Front Door	103.3	100	105	105
11	Center Panel Right				
12	Right Rear Door	104.6	105	101	108
13	Right Back Panel	112.0	108	109	119

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks Bonnet, Headlight - Scratch & Dent - Medium / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Dent - Small / (L) Front Fender, Molding - Scratch - Small
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
front Toyota emblem loose. swirlmarks and hairline scratches around the exterior. with warranty booklet, user manual and tools.