

General Information

Date & Time: 28, Jul, 2025 17:19

Make	Mitsubishi	Model	Mirage
YOM	2024	Odo Meter Reading	10,592
Registration No.	NIR9293	Chassis No.	PAEA13TJRPA018128
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



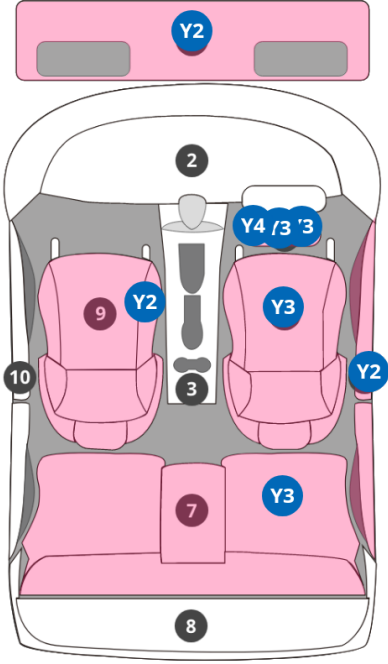
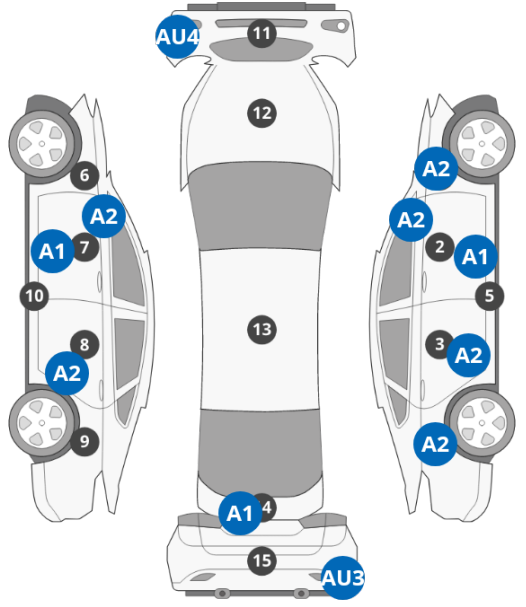
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	172.6	130	232	156
2	Boot Lid	105.1	99	116	101
3	Roof	100.1	98	104	97/102
4	Left Front Fender	99.3	105	96	97
5	Left Front Door	103.3	105	103	102
6	Center Panel Left				
7	Left Rear Door	97.1	101	96	94
8	Left Back Panel	111.6	120	115	100
9	Right Front Fender	105.3	105	103	108
10	Right Front Door	106.0	108	103	107
11	Center Panel Right				
12	Right Rear Door	105.4	103	99	114
13	Right Back Panel	108.0	100	109	115

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / (L) Front Floor Mat - Grime - Large / (L) Front Seat - Grime - Small</p>	<p>Remarks Bonnet - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Without warranty booklet and tools. With spare tire and jack. 1 key. With LTO plate.</p>