

General Information

Date & Time: 28, Jul, 2025 16:44

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	38,700
Registration No.	NIE1576	Chassis No.	PA1B18F34N4186748
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



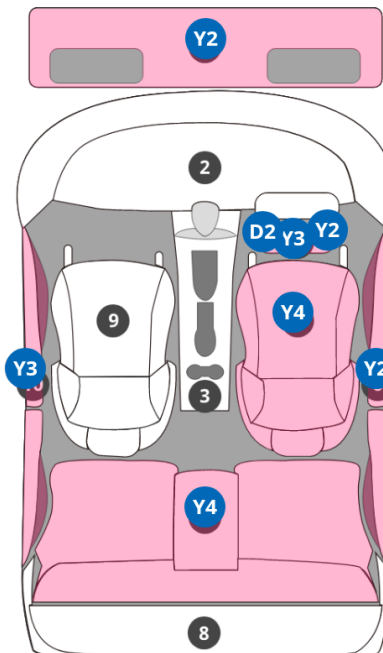
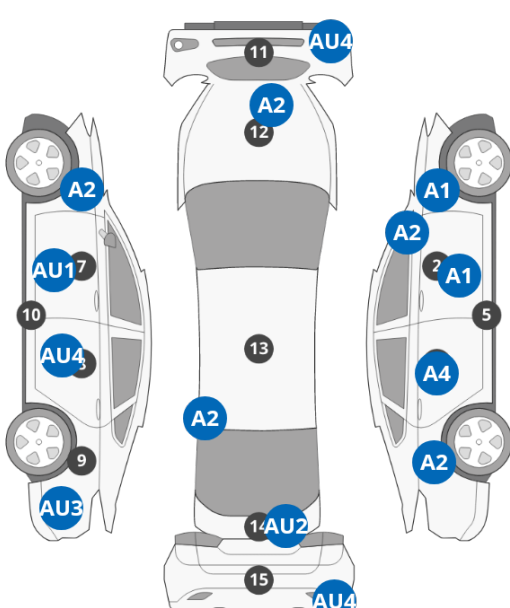
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.1	92	100	108
2	Boot Lid	113.3	112	114	114
3	Roof	96.4	96	91	94/105
4	Left Front Fender	97.8	109	86	99
5	Left Front Door	98.4	105	96	94
6	Center Panel Left				
7	Left Rear Door	121.3	108	122	134
8	Left Back Panel	105.6	115	99	103
9	Right Front Fender	422.3	115	161	991
10	Right Front Door	94.3	90	93	100
11	Center Panel Right				
12	Right Rear Door	98.8	98	99	100
13	Right Back Panel	102.9	99	99	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>all seats has molds. With warranty booklet. Without spare tire,jack,tools and seat cover. 1 key. With LTO plate.</p>