

General Information

Date & Time: 28, Jul, 2025 13:29

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	57,604
Registration No.	NIN2218	Chassis No.	MHFAA1BY7P0013725
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



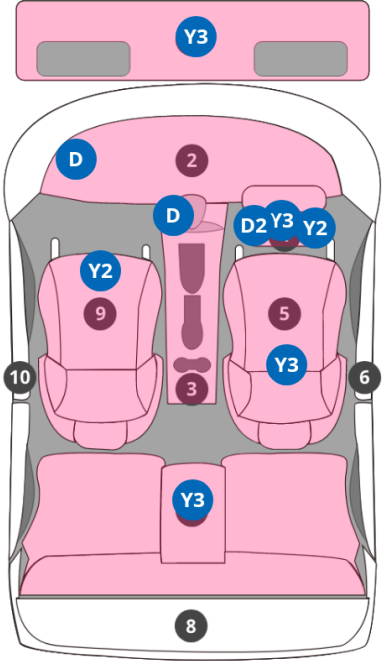
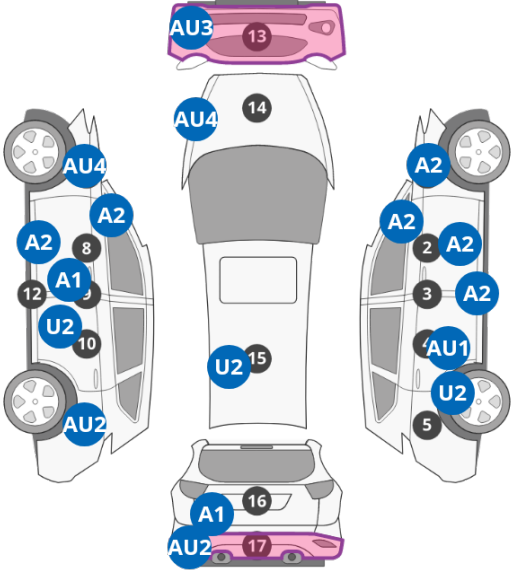
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	105	108	107
2	Boot Lid	119.3	129	127	102
3	Roof	109.8	118	111	99/112
4	Left Front Fender	102.5	95	103	110
5	Left Front Door	113.6	107	110	124
6	Center Panel Left				
7	Left Rear Door	112.6	120	107	111
8	Left Back Panel	106.6	110	102	108
9	Right Front Fender	103.7	112	102	97
10	Right Front Door	114.6	118	114	112
11	Center Panel Right				
12	Right Rear Door	116.0	117	114	117
13	Right Back Panel	106.8	105	97	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Medium / Mat Other - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Seats has molds. Adhesive marks at rear view mirror. Without warranty booklet, seat cover and tools. With spare tire and jack. 1 key. With LTO plate.</p>