

General Information

Date & Time: 28, Jul, 2025 16:15

Make	Mitsubishi	Model	Mirage
YOM	2019	Odo Meter Reading	63,037
Registration No.	NDP4992	Chassis No.	PAEA13TXKKA007131
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



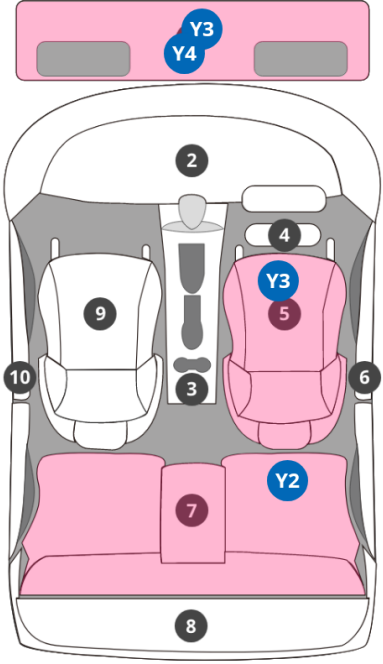
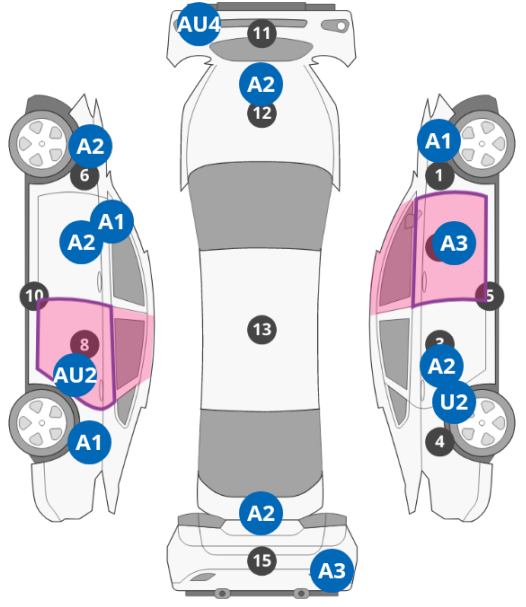
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	107	120	112
2	Boot Lid	115.6	114	121	112
3	Roof	97.5	91	96	98/105
4	Left Front Fender	110.3	114	109	108
5	Left Front Door	111.6	110	108	117
6	Center Panel Left				
7	Left Rear Door	110.0	116	107	107
8	Left Back Panel	123.3	136	122	112
9	Right Front Fender	104.6	103	102	109
10	Right Front Door	114.6	119	113	112
11	Center Panel Right				
12	Right Rear Door	110.0	105	106	119
13	Right Back Panel	118.0	105	124	125

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Large / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Gap at front and rear bumper, Without warranty booklet, jack and tools. With spare tire. 1 key. With LTO plate.</p>