

General Information

Date & Time: 28, Jul, 2025 12:59

Make	Hyundai	Model	Accent
YOM	2020	Odo Meter Reading	46,039
Registration No.	LAG7447	Chassis No.	PEH841BALH004402
CC	1.4	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



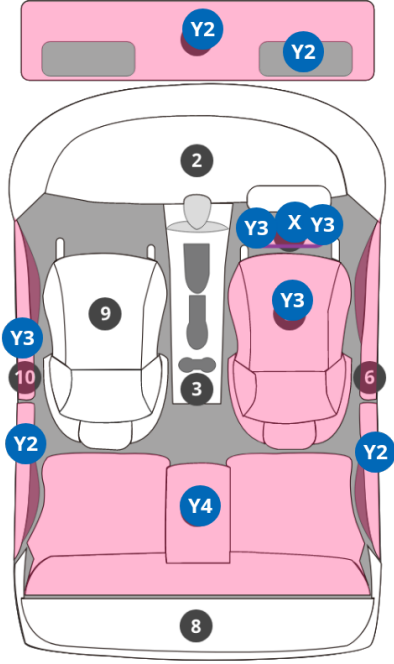
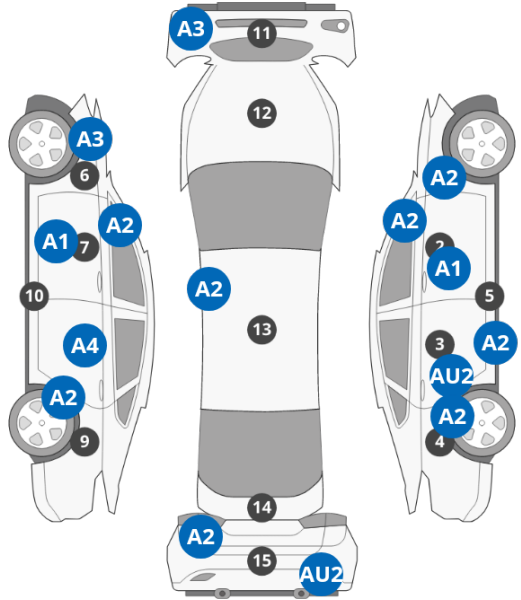
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	215.3	288	180	178
2	Boot Lid	108.2	115	98	112
3	Roof	141.7	135	140	149/143
4	Left Front Fender	163.6	167	152	172
5	Left Front Door	222.6	226	237	205
6	Center Panel Left				
7	Left Rear Door	145.0	152	160	123
8	Left Back Panel	119.6	119	116	124
9	Right Front Fender	115.6	123	119	105
10	Right Front Door	147.6	153	153	137
11	Center Panel Right				
12	Right Rear Door	155.0	151	147	167
13	Right Back Panel	161.0	144	142	197

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / Mat Other - Missing - Yes / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Window lock switch issue. After market remote key and alarm system. Without warranty booklet and tools. With spare tire and jack. 1 key. With LTO plate.</p>