

General Information

Date & Time: 05, Aug, 2025 18:52

Make	Toyota	Model	Hiace
YOM	2021	Odo Meter Reading	71,224
Registration No.	DAU7720	Chassis No.	JTFJT02P5M5026373
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



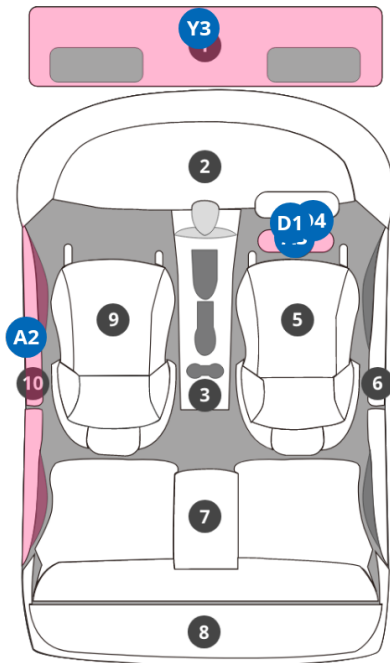
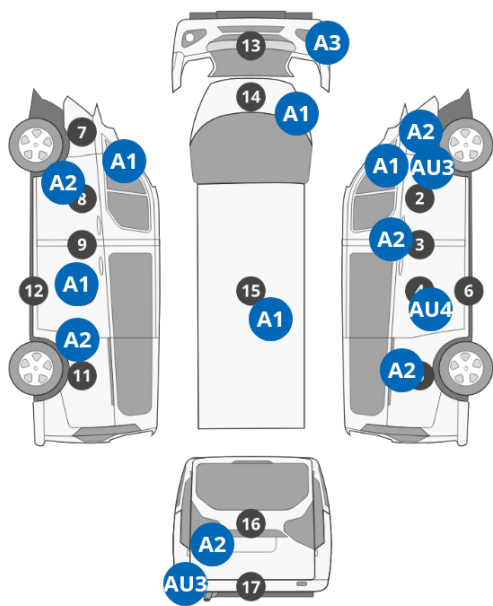
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	81.6	77	91	77
2	Boot Lid	190.0	182	199	189
3	Roof	72.8	74	79	68/70
4	Left Front Fender	87.3	86	91	85
5	Left Front Door	70.3	69	65	78
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	172.6	174	209	135
9	Right Front Fender	91.1	96	87	90
10	Right Front Door	69.3	73	61	74
11	Center Panel Right	75.6	82	79	67
12	Right Rear Door	69.1	72	67	68
13	Right Back Panel	74.7	74	76	74

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Floor Mat - Worked - Large / Carpet - Worked - Minimal / (L) Front Trim - Cut, Crack - Small	Remarks (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Center Panel - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Front Panel - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail, battery weak,