

General Information

Date & Time: 30, Jul, 2025 17:11

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	35,207
Registration No.	NFC6904	Chassis No.	MHKA4DF5FPJ080178
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Black		

Body / Panel Condition



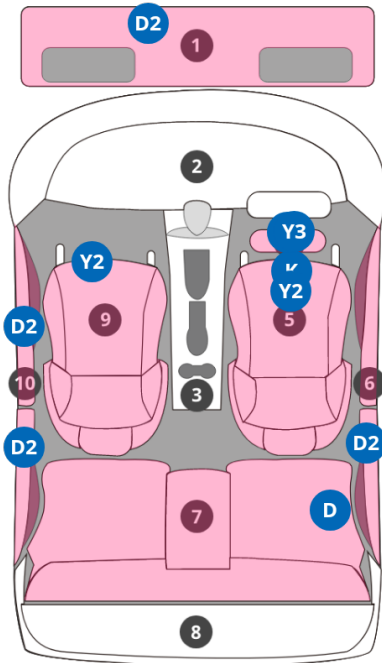
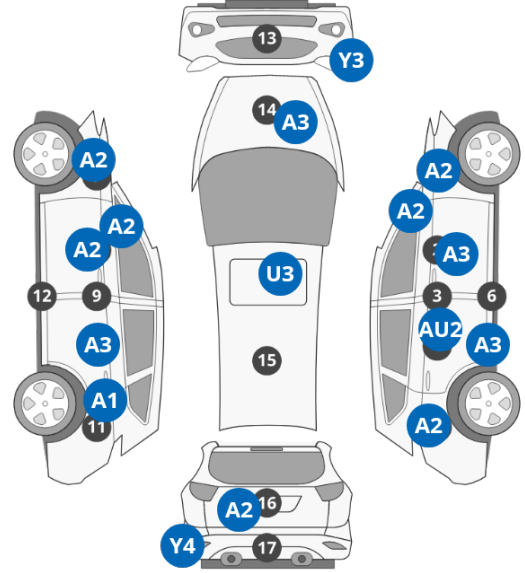
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.8	99	110	106
2	Boot Lid	106.6	101	110	109
3	Roof	93.0	88	97	102/85
4	Left Front Fender	96.8	88	102	101
5	Left Front Door	96.1	94	96	98
6	Center Panel Left				
7	Left Rear Door	93.4	100	92	89
8	Left Back Panel	103.6	104	100	107
9	Right Front Fender	94.9	100	98	87
10	Right Front Door	95.1	90	99	96
11	Center Panel Right				
12	Right Rear Door	93.8	100	89	92
13	Right Back Panel	104.3	106	101	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / (R) Front Seat - Grime - Small / Rear Seat - Worn - Yes / (R) Front Trim - Worked - Small / (L) Front Seat - Grime - Small / Mat Other - Grime - Small / (R) Front Floor Mat - Grime - Medium / (L) Front Trim - Worked - Small / (L) Rear Trim - Worked - Small / Ceiling - Crinkle - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Medium / Roof - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light