

General Information

Date & Time: 07, Aug, 2025 10:14

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	41,304
Registration No.	NFR2129	Chassis No.	PA1B18F3XR4248353
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



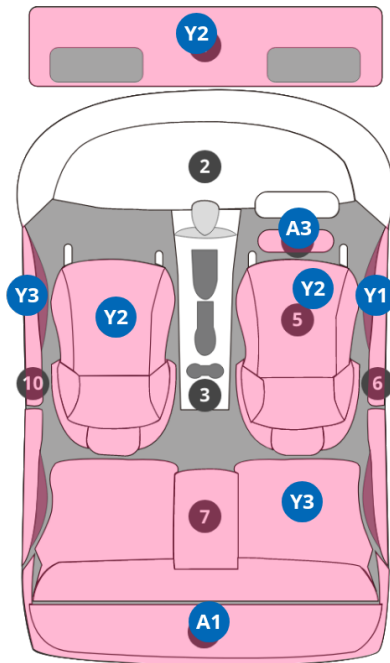
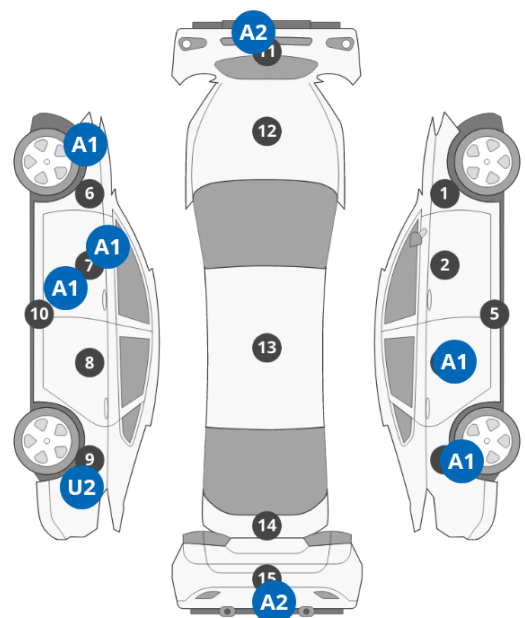
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.3	131	142	121
2	Boot Lid	112.6	108	114	116
3	Roof	122.2	124	125	114/126
4	Left Front Fender	107.3	108	107	107
5	Left Front Door	106.0	108	107	103
6	Center Panel Left				
7	Left Rear Door	116.6	124	117	109
8	Left Back Panel	118.6	123	114	119
9	Right Front Fender	112.6	120	111	107
10	Right Front Door	116.6	122	115	113
11	Center Panel Right				
12	Right Rear Door	117.3	107	116	129
13	Right Back Panel	115.0	117	110	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium / Ceiling - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Grime - Medium	Remarks (L) Rear Fender, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with LTO plate/with spare tire/with jack and tools/with spare key/with reverse camera/with warranty booklet